

THE CARBURIZATION OF STEELS OF
"KRUPP" ANALYSIS
—•—•—•—
WALTER JONES WHIPPLE

U. S. Naval Postgraduate School
Monterey, California

CARNEGIE INSTITUTE OF TECHNOLOGY

THESIS

THE CARBURIZATION OF STEELS OF "KRUPP" ANALYSIS

Submitted in partial fulfilment of the requirements for
the degree of

MASTER OF SCIENCE IN METALLURGY

Walter Jones Whipple

Department of Metallurgy

Approved May 14, 1936.

Vsevelod N. Krivobok

Faculty Advisor.

Approved by the Committee on Graduate Instruction.

Charles Watkins.

Ph. D.

TABLE OF CONTENTS

	Page.
Synopsis	1
Introduction	2
The Process of Carburization	3
Temperature and Its Effect on Rate of Carburization.	4
Carburizing Medium and Its Effect on Rate of Carburization	4
Constitution and Structure of the Steel and its Effect on Rate of Carburization	6
Properties of the Material Under Test	9
Experimental Procedure	10
Results	13
Effect of Initial Structure of Steel on Rate of Carburization .	13
Effect of Varying Alloy Content of Steel on Rate of Carburization	14
Discussion	17
Acknowledgement	19
Photomicrographs	20
Curves	30
Tables	33
Bibliography	36

SYNOPSIS

Samples of four lots of steel containing between 1.75 and 3.79% nickel and between 0.73 and 1.72% chromium were carburized to obtain information on the factors affecting rates and depths of carbon penetration. A review of previous work on carburization and diffusion of carbon is presented, and the relative importance of factors affecting rate of carburization is discussed. It was found that initial grain size had a marked effect on rate of carburization of a steel, and that the variation in alloy content among the different lots of steel had a slight effect on respective rates of carburization.

STUDY

Analysis of four days of study containing between 2 to 100

of subjects and between 1.75 and 1.90 hours per subject to

which information on the relative attention span and amount of out-

put was obtained. A series of studies with an experimental design

which is similar to that of the present study, and the results of the

present study is summarized in the following. It was found that the

total amount of time and a certain amount of attention of a

subject, and that the variation in time spent on different

tasks of work was a slight effect on the total time of work.

Thus,

INTRODUCTION

Few processes have received the attention of metallurgists over a longer period of time than that of carburization of iron and steel. The many variables which affect the process, as well as the differing objectives which have determined the procedures of the respective investigators, have prevented a complete understanding of the laws governing rates and depths of carburization.

It would be out of the question to do justice to, or even to tabulate, in a single paper, the many contributions to our knowledge of this most interesting subject. The review of the subject which precedes the description of the experimental work, therefore, will be restricted to an analysis of factors affecting rates and depths of carburization. It seems well worth while to direct attention to the importance of an understanding of the laws governing rates of diffusion in solid metals for this purpose, as well as to the factors peculiar to reactions in the gaseous medium, which force us to modify our concept of diffusion as a measure of rate of carburization.

[illegible]

It would be out of the question to do justice to, at least to
 mention, in a single volume, the many considerations to be taken
 of this most important subject. The reader of the subject will
 however be acquainted with the numerous works, therefore, will
 be enabled to do justice to the subject of this and other
 of education. It seems well worth while to direct attention to
 the importance of an understanding of the law governing the
 diffusion of light within the system, as well as to the factors
 leading to variation in the growth system, which form an so much
 our subject of diffusion as a means of rate of oxidation.

THE PROCESS OF CARBURIZATION

The surface of a steel specimen is carburized by heating in the presence of a carburizing agent. The essential conditions for carburizing are: that the steel be heated to the austenitic range; that the initial carbon content of the steel be below the limit of solubility at the carburizing temperature; that the carburizing agent react with the iron in such a manner as to give up carbon to the latter.

In carburizing, then, there is a gaseous system which supplies a compound capable of carburizing steel. (The discussion of carburizing with liquids is omitted). There is also a solid system in which the carbon atoms /29/ (or the Fe_3C molecules /21/) diffuse away from the surface, because of the concentration gradient of carbon. At the boundary between the two systems, which may be referred to as the interface, the carburizing gas gives up carbon to the iron, as has been stated.

EQUILIBRIUM

Strictly speaking, equilibrium does not occur in the carburizing process, and every step should be analyzed in terms of rates of reaction. The gaseous system at a distance from the interface is practically in equilibrium, and if carbon is available, as in pack-carburizing, CO_2 will be reduced to CO until the pressures of these two gases are practically at equilibrium for the temperature existing. The solid system is likewise practically at equilibrium at a distance from the interface.

THE THEORY OF ORGANIZATION

The system of a social system is organized to achieve its purpose in a coordinated manner. The organized conditions for organization exist and the aim is to be achieved in the social system. The social system is organized to achieve its purpose in a coordinated manner. The organized conditions for organization exist and the aim is to be achieved in the social system. The social system is organized to achieve its purpose in a coordinated manner. The organized conditions for organization exist and the aim is to be achieved in the social system.

In organization, there is a process of social organization. The organized conditions for organization exist and the aim is to be achieved in the social system. The social system is organized to achieve its purpose in a coordinated manner. The organized conditions for organization exist and the aim is to be achieved in the social system. The social system is organized to achieve its purpose in a coordinated manner. The organized conditions for organization exist and the aim is to be achieved in the social system.

CONCLUSION

Finally, organization is a process of social organization. The organized conditions for organization exist and the aim is to be achieved in the social system. The social system is organized to achieve its purpose in a coordinated manner. The organized conditions for organization exist and the aim is to be achieved in the social system. The social system is organized to achieve its purpose in a coordinated manner. The organized conditions for organization exist and the aim is to be achieved in the social system.

TEMPERATURE AND ITS EFFECT ON RATE OF CARBURIZATION

The carburizing temperature affects the rate of carburization in various ways.

A high temperature increases rate of diffusion in the solid metal by its effect on the diffusion coefficient (equation 4); and affects the rate of reaction of carbon and iron at the interface. A high temperature also increases the concentration of carburizing gas in such processes as that of pack-carburizing.

The carbon content of the metal at the interface is less than the limiting solubility of the carbon in the metal, which depends on the temperature, as reference to the equilibrium diagram of the iron-carbon system will show. There is evidence /6/ that this solubility limit is approached quite closely in practice, but is in general not reached, by the metal at the interface.

From these considerations it appears that the relation between temperature and rate of carburization is a complex one, and data on the relation of these two variables appearing in the literature /6//26/, are most useful for predicting results of carburization. This type of information is less useful for analysis of variations in rates of carburization, especially in the case of pack-carburizing, because of the difficulty of making accurate corrections for temperature variations.

CARBURIZING MEDIUM AND ITS EFFECT ON RATE OF CARBURIZATION.

Soudremont /6/ reports that a powdered mixture of charcoal 60% by weight and 40% barium carbonate produces a deeper case at moderate carburizing temperatures than illuminating gas or a selected mixture of organic carburizing agents. The same work gives data on other

THE HISTORY OF THE UNITED STATES

The following is a list of the names of the persons who have been

connected with the history of the United States.

The names of the persons who have been connected with the history of the United States are as follows:

1. The names of the persons who have been connected with the history of the United States are as follows:

2. The names of the persons who have been connected with the history of the United States are as follows:

3. The names of the persons who have been connected with the history of the United States are as follows:

4. The names of the persons who have been connected with the history of the United States are as follows:

5. The names of the persons who have been connected with the history of the United States are as follows:

6. The names of the persons who have been connected with the history of the United States are as follows:

7. The names of the persons who have been connected with the history of the United States are as follows:

8. The names of the persons who have been connected with the history of the United States are as follows:

9. The names of the persons who have been connected with the history of the United States are as follows:

10. The names of the persons who have been connected with the history of the United States are as follows:

11. The names of the persons who have been connected with the history of the United States are as follows:

12. The names of the persons who have been connected with the history of the United States are as follows:

13. The names of the persons who have been connected with the history of the United States are as follows:

14. The names of the persons who have been connected with the history of the United States are as follows:

15. The names of the persons who have been connected with the history of the United States are as follows:

16. The names of the persons who have been connected with the history of the United States are as follows:

17. The names of the persons who have been connected with the history of the United States are as follows:

18. The names of the persons who have been connected with the history of the United States are as follows:

19. The names of the persons who have been connected with the history of the United States are as follows:

20. The names of the persons who have been connected with the history of the United States are as follows:

THE HISTORY OF THE UNITED STATES

The following is a list of the names of the persons who have been

connected with the history of the United States.

The names of the persons who have been connected with the history of the United States are as follows:

21. The names of the persons who have been connected with the history of the United States are as follows:

carburizing agents which have even lower carburizing rates. For long carburizing times and temperatures above 950°C . the differences in the rates of carburization obtained under these different conditions become much less /6/, as the carbon concentration at the interface approaches the limit of solubility.

Bramley //26//27//28//29// reports that rate of carburization is greater with either pyridine, methyl cyanide, or ammonia added to CO than when CO is used alone. In each case increasing the rate of supply of the gas increased the rate of carburization. Temperatures from 800 to 1000°C ., times from 5 to 40 hours, and rates of supply of gas from 7 to 30 liters per hour per sample, were used.

Comparison of this work of Bramley with that of Houdremont and Schrader /13/, shows that Charcoal 60% barium carbonate 40% gives as rapid carburization as pure CO if the rate of supply of CO is low, about 15 liters per hour for the conditions existing in Bramley's experiments.

Recent industrial experience /12/ demonstrates that under favorable conditions a combination of CO and hydrocarbon gas produces a higher rate of carburization than CO alone.

It is known that the rate of carburization using charcoal alone in the pack-carburizing process is relatively low.

On the basis of the above information we may conclude that the rate of carburization as measured by the depth of case is approximately proportional to the pressure of CO present. Langenberger /17/ determined this relation experimentally. However, if other carburizing gases are present as well as CO a rate of carburization higher than that obtained with CO alone is observed under some conditions.

It seems most reasonable to postulate that if more than one

...the ... of ...
...the ... of ...
...the ... of ...
...the ... of ...
...the ... of ...

...the ... of ...
...the ... of ...
...the ... of ...
...the ... of ...
...the ... of ...


...the ... of ...
...the ... of ...
...the ... of ...
...the ... of ...
...the ... of ...

...the ... of ...
...the ... of ...
...the ... of ...
...the ... of ...
...the ... of ...

...the ... of ...
...the ... of ...
...the ... of ...
...the ... of ...
...the ... of ...

carburizing gas is present the reactions in the gaseous state proceed more rapidly, so that more carbon can combine with the iron in a given time than would otherwise be the case.

Consider the reactions which take place in carburizing with carbon and an energizer /21/:

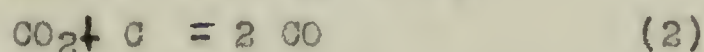

If some agent more active than carbon in reducing CO_2 to CO were present, it is reasonable to suppose that carburization would proceed at a more rapid rate.

The carbon content of the surface of the steel cannot be measured very accurately, and figures usually given are the carbon content of a very thin layer removed from the surface. The actual carbon content of the surface approaches the limit of solubility of the steel at the carburizing temperature, and depends on the relative rates of solution of carbon and of diffusion of carbon. If the rate of solution of carbon is relatively low, the carbon content of the surface will likewise be low. For high temperatures and long carburizing times, changing the carburizing medium has relatively little effect on the carbon concentration at the surface and on case depth. /6/

THE CONSTITUTION AND STRUCTURE OF THE STEEL AND ITS EFFECT ON RATE OF CARBURIZATION.

The rate of carburization may be expected to vary with the alloy content of the steel. The limit of solubility of carbon in a steel at a given temperature will vary with the alloy content. Furthermore, it is to be expected that rates of diffusion in different alloys will vary. Houdrement and Schrader /13/ have determined the variation in rate of carburization when up to 6% of an alloying element has been

...the

[illegible]

It was found that the above information was obtained from the files of the FBI, New York Office, dated 10-17-68.

The second volume of the history of the royal family is devoted to the reign of Louis XV. It is a very interesting and important work, and it is one of the best of its kind. It is written in a very clear and concise style, and it is full of interesting details. It is a very valuable work, and it is one of the best of its kind.

The text of this document is not legible due to extreme blurring. It appears to be a multi-paragraph letter or report, but the specific content cannot be transcribed.

added to steel. A number of common alloying elements were so added, and in most cases the rate of carburization was thereby decreased. Houdremont /6/ has determined that the carbon content within 0.05 m.m. of the surface of several steels when carburized under similar conditions varied as follows: Nickel-chromium steel highest, nickel steel next, carbon steel lowest.

The thickness of the case is dependent on the rate of diffusion of carbon in the metal.

Diffusion of metals in the solid state obeys Fick's law: /22/:

$$D_m = D A \frac{(dc)}{(dx)} dt \quad (3)$$

Where a mass dm of a substance diffuses across an area A in time dt .

dc/dx is the concentration gradient of the diffusing substance, where c is concentration, and x is distance from the interface of the solute metal.

D is the diffusion coefficient, which has been calculated by the Dushman-Langmuir equation as:

$$\log_e D = \log_e \frac{QS^2}{Nh} - \frac{Q}{RT} \quad (4)$$

Where Q is heat of diffusion or solution.

N is Avogadro's number

h is Planck's constant

R is the gas constant

T is the absolute temperature

$$e = 2.718 +$$

S is the interatomic distance.

It has been observed that D varies to some extent as concentration of solute (c) varies, and this is not indicated by equation (4).

From equation (4) it is apparent that the diffusion coefficient is much larger at higher temperatures, and also that its value depends on the properties of the solute material (in the steel). Equation (4) does not indicate the effect which the presence of one or more alloying elements would have on the diffusion coefficient of carbon in iron.

From consideration of equations (3) and (4) it is observed that rate of carburization, as measured by mass of carbon diffused into the metal, is greater if the carbon gradient (dc/dx), the diffusion coefficient (D), or the absolute temperature (T), is greater.

Furthermore, a greater carbon concentration at the interface will produce a greater depth of case; a large diffusion coefficient will produce a greater depth of case, other conditions being equal.

Mehl /22/ has presented a review of the subject of diffusion in solid metals. It may be said that the theory thus presented has great potential value for analysis of carburization processes. Unfortunately most of the research in carburization yields too little information to permit computation of diffusion coefficients, and thus fails to contribute to knowledge of diffusion. In particular, evaluation of the quantity " $\frac{dm}{dt}$ " equation (3) would be most useful. The total mass of carbon diffused (the area under the depth-concentration curve) gives a means of estimating relative magnitude of mass " m ". (equation 3).

Additional data is needed if the true value of " $\frac{dm}{dt}$ " is to be computed.

No information is available on the effect of the structure of a given alloy on the rate of carburization which may be attained. At the carburizing temperature the steel is austenitic and the effects of previous treatment are not apparent in the structure. However,

[illegible][illegible]

ADDITIONAL INFORMATION IS AVAILABLE AT THE OFFICE OF THE DIRECTOR, FBI, WASHINGTON, D.C. 20535.

there are properties of the steel associated with the McQuaid-Ehn grain size /2//3//20//23/ which are retained after heating and cooling steel through the austenitic range. In spite of the work of Grossman /2//3/ and others the true cause of the inherent grain size of the steel is not definitely known. It is at least possible that the previous treatment of the steel may have some effect on its rate of carburization.

PROPERTIES OF THE MATERIAL UNDER TEST

Two steels of an alloy content approximating that of Krupp armor steels, and two steels of somewhat lower alloy content were selected for test. Analyses of these steels are given in Table I. They were selected from several regular lots offered by commercial concerns, the idea being to conduct the tests on samples representative of good commercial practice.

These steels are characterized by very high strength, good ductility, toughness, and resistance to shock; and are sluggish in response to heat treatment, becoming pearlitic only when annealed slowly. Steels of Krupp analysis are known to be susceptible to temper brittleness under some conditions of heat treatment.

Steel SAE No. 1020 is a plain carbon steel included in the investigation as a control.

The material was furnished by the respective manufacturers in rods approximately 1" in diameter. Steels A and B being hot rolled and steels C, D and E being hot forged. The samples were examined for elongated grains which would indicate too low finishing temperature. None were found.

Table III gives the data on critical points of these steels,

THESE ARE THE RESULTS OF THE INVESTIGATION OF THE
CASE OF THE DEATH OF THE LATE MR. JAMES W. HARRIS
AND THE RESULTS OF THE INVESTIGATION OF THE
CASE OF THE DEATH OF THE LATE MR. JAMES W. HARRIS
AND THE RESULTS OF THE INVESTIGATION OF THE
CASE OF THE DEATH OF THE LATE MR. JAMES W. HARRIS

The study of the effect of the concentration of the solution on the rate of the reaction was carried out at 25°C. The rate of the reaction was measured by the change in the optical density of the solution at 440 mμ. The results are shown in Table I. The rate of the reaction increases with increasing concentration of the solution. The rate of the reaction is also affected by the nature of the solvent. The rate of the reaction is highest in water and lowest in organic solvents. The rate of the reaction is also affected by the nature of the catalyst. The rate of the reaction is highest with potassium permanganate and lowest with ceric sulfate. The rate of the reaction is also affected by the nature of the substrate. The rate of the reaction is highest with benzene and lowest with toluene. The rate of the reaction is also affected by the nature of the product. The rate of the reaction is highest with benzene and lowest with toluene.

the values given in the literature /21/ for the nominal composition being corrected for variations from this composition by use of factors determined by Reed /18/. In no case did the value of this correction exceed 30°F. The values of carbon content of the eutectoid are also based on work of Reed./18/.

This work of Reed, while not very accurate, is the best that is available for the purpose.

EXPERIMENTAL PROCEDURE

In order to determine the effect of initial structure of the sample on rate of diffusion, samples of each steel were heated to various temperatures, for various times, as indicated in Table II.

Various means were used to protect the specimens from oxidation in the cases of Steels A and B, Steels C and D, and E, were treated in a chromium steel container in a nitrogen atmosphere. A Westinghouse Globar furnace was used, with automatic temperature control, and a separate thermocouple was used to check temperatures as close to the specimens as possible.

Each specimen was centered in a lathe, and turned accurately to a cylinder. In so doing, a layer of metal from 1/16" to 1/8" thick was cut off from the surface, thus disposing of material which might have undergone decarburizing during ^{heat treatment.} A feed of 0.005" per revolution was used on the final cut to give uniform surface

The specimens were then carburized in batches as indicated in Table II, in a mixture of 60% powdered charcoal by weight, and 40% powdered barium carbonate. It should be noted at the temperatures used the samples were initially above the upper critical point (Ac3) and hence austenitic. The original grains were recrystallized.

The value given in the literature for the critical temperature of the
being corrected for variations from this temperature by use of the
determined by Good (1911). In the case of the value of the
critical 297. The value of critical temperature of the critical is the
found on page of Good (1911).

This value of Good, which was used, is the best that
is available for the purpose.

EXPERIMENTAL

In order to determine the effect of initial temperature of the
sample on rate of diffusion, samples of same size were heated to
various temperatures, the diffusion time, as indicated in Table II.
Various sizes were used to obtain the diffusion time indicated
in the case of Table II and I, Table I and II, and Table I.
In a diffusion cell consisting of a diffusion chamber, a diffusion
chamber, and a diffusion chamber, the diffusion time was measured.
The a diffusion chamber was used in some experiments as also
in the diffusion in certain.

The diffusion was measured in a 1000, and the diffusion
in a diffusion. In the case of a 1000, the diffusion was
measured in a 1000, and the diffusion was measured in a 1000.
The diffusion was measured in a 1000, and the diffusion was
measured in a 1000, and the diffusion was measured in a 1000.
The diffusion was measured in a 1000, and the diffusion was
measured in a 1000, and the diffusion was measured in a 1000.
The diffusion was measured in a 1000, and the diffusion was
measured in a 1000, and the diffusion was measured in a 1000.
The diffusion was measured in a 1000, and the diffusion was
measured in a 1000, and the diffusion was measured in a 1000.

Every sample was carburized 12 hours at the temperature indicated in Table II; this time does not include time to raise the specimen to temperature or cool it. The cooling rates varied in a regular manner from 2°F. per minute shortly after the current was turned off to 1°F. per minute at about 300°F.; and from 300°F. to room temperature cooling, Rates were below 1°F. per minute.

After cleaning, the specimens were returned to the lathe and successive layers of metal 0.0070" to 0.0150" thick were removed and the turnings analyzed for carbon content by the combustion method. Careful records were kept of the diameters of the specimens after each operation in order that the location of each sample of metal analyzed might be used in plotting curves of carbon concentration against depth. A sufficient length was left on each specimen so that a sample 1" from the end of the specimen could be removed for microscopic examination. Photomicrographs which appear to be of interest are included in this report.

Conclusions in regard to rates of carburization were based on examination of depth-carbon concentration curves. This technique gives more accurate measure of depth of case than visual examination of microstructures and also reveals the distribution of carbon within the case.

The relative mass of carbon diffused, as given by the tables, may be converted to lb. of carbon per square inch of area per hour by multiplying by 5.9×10^{-13} .

In making up the tables, the area under the depth-carbon concentration curve was measured down to the 0.25% carbon ordinate in the case of Steel A and down to the 0.40% carbon ordinate in the case of Steels B, C, D, and E. These values correspond to the approximate carbon contents of the original samples. The purpose of

[illegible][illegible]

The Ministry of Justice, in view of the fact that the Ministry of Justice is not in a position to provide the necessary information, has referred the matter to the Ministry of the Interior.

this procedure was to omit from the calculations the original carbon contents, and base conclusions on the mass of carbon added in each case.

Furthermore, errors due to minor variations in initial carbon content are thus reduced to negligible proportions. ^{The}~~Steel~~ initial diffusion rate is higher due to higher carbon gradient. (Equation 3.) The error due to low initial carbon content of steel A is "on the side of safety". No matter what its numerical value, it can not affect the verity of the conclusion to be stated.

RESULTS

Effect of initial structure on rate of carburization.

Table II and figure 11 show that rate of carburization in Steel C is practically independent of initial grain size as produced by annealing. Steel C has a slightly lower alloy content than the usual Krupp analysis of armor steel. Rate of carburization is very slightly increased by long heating just below the critical range, so that the sample is partly spheroidized. (Specimen C 4).

The rate of carburization of Steel D is increased to a marked degree by increasing initial grain size by annealing, as may be noted by reference to Table II and figures 11 and 14. The rate of carburization is also increased by spheroidizing treatment. (Specimen D 4).

The rate of carburization of Steel E is practically independent of initial heat treatment. (Table II figure 11).

The rate of carburization of Steel A, which is a plain carbon steel, is increased somewhat by annealing to increase grain size (Table II and figures 12 and 15). A somewhat greater increase in rate of carburization was obtained by a quenching treatment. (Specimens A 5 and A 6).

In Steel B, which has an alloy content slightly greater than the usual Krupp analysis for armor steel, the effect of initial structure was in part obscured by the variety of heat treatments undertaken. A coarse-grained structure obtained by air cooling (martensitic) permitted a lower rate of carburization than a structure obtained by annealing. (Table II and figures 12 and 16).

The average mass of carbon diffused is computed in each case where a number of samples had received identical treatment, and the

RESULTS

Effect of temperature on rate of sorption.

Table I and Figure 1 show the effect of temperature on the

rate of sorption. The rate of sorption is also shown by an

example. When the rate of sorption is plotted against the weight

of the sample, the rate of sorption is also shown by an

example. When the rate of sorption is plotted against the weight

of the sample, the rate of sorption is also shown by an

example. When the rate of sorption is plotted against the weight

of the sample, the rate of sorption is also shown by an

example. When the rate of sorption is plotted against the weight

of the sample, the rate of sorption is also shown by an

example.

The rate of sorption of water is also shown by an

example. When the rate of sorption is plotted against the weight

of the sample, the rate of sorption is also shown by an

example. When the rate of sorption is plotted against the weight

of the sample, the rate of sorption is also shown by an

example. When the rate of sorption is plotted against the weight

of the sample, the rate of sorption is also shown by an

example. When the rate of sorption is plotted against the weight

of the sample, the rate of sorption is also shown by an

example. When the rate of sorption is plotted against the weight

of the sample, the rate of sorption is also shown by an

example. When the rate of sorption is plotted against the weight

of the sample, the rate of sorption is also shown by an

example. When the rate of sorption is plotted against the weight

of the sample, the rate of sorption is also shown by an

results tabulated in the last four lines of Table IV.

Effect of alloy content on rate of carburization. (Figures 11 and 12).

In analyzing the effect of alloy content on rate of carburization, it is necessary to make allowance for the effect of initial grain size. If the results for all samples of each steel are considered, as averaged in Table IV, Steel A has the lowest rate of carburization, C and E carburize at the same rate, and Steel D has the highest rate. Steel B was carburized at a lower temperature, and the rate of carburization was low. No definite conclusion can be drawn by comparing this rate with rates of carburization of the other steels. If the carburizing rates of the steels in the fine-grained condition are compared, (Table II), it will be observed that Steel D carburizes at the same rate as steels C and E, Steel A still showing the lowest rate of carburization.

Carbon, chromium, molybdenum, and to a less degree manganese, may be lost from the surface of the specimen in heat treating.

Examinations of the microstructure indicated that the layer of metal removed after heat treating was in each case sufficient to assure that the sample as carburized was homogeneous and the original alloy content unaltered, except in samples A4, B3, B4 and B5. As the layer removed from Sample E1 was comparatively thin, a chromium analysis was made of the outer layer removed after carburization, in addition to the carbon analysis. Chromium content was 0.71% as compared with an original chromium content of 0.75%. From this it was concluded that the original alloy content was not changed sufficiently to affect the results. Specimen A4 was almost completely

... ..

... ..

... ..

... ..

... ..

... ..

... ..

... ..

... ..

... ..

... ..

... ..

... ..

... ..

... ..

... ..

... ..

... ..

... ..

... ..

... ..

... ..

... ..

... ..

... ..

... ..

... ..

decarburized before carburizing. (Table II). The rate of carburization was 20% less than in a sample which had received a similar heat treatment and which had been protected from decarburization. This result is consistent with the findings of Bramley /26/.

Notes on microstructure.

The grain size of both the case and the core of Steels A and D after carburizing was influenced by the initial grain size, initially coarse-grained samples showing larger grains after carburizing in both the case and the core. (Figures 3, 4, 7). These steels were carburized less than 200° F. above the upper critical (Ac3) point. The final grain size of Steels C and E carburized more than 200° F. above the Ac3 point was independent of the initial grain size.

The depth of carburization as determined by microscopic examination of the etched specimens at 10x and 100x was consistent with the determinations based on carbon analysis in the cases of Steels A and B, and was inaccurate in the cases of Steels C and D. The observed depth of case is sensitive to minor changes in technique in etching with 4% nitric acid in alcohol.

The determination of grain size by comparing with standard grain size charts and converting grain size number to linear dimension of the grain by computation was found the most satisfactory method, in view of the variation in the microstructures of the different steels. In the spheroidized steels, for example, it would be difficult to devise a grain count method that would describe the appearance of the steel.

15
The results of the investigation are as follows: The rate of absorption of the gas is not affected by the rate of stirring of the liquid. The rate of absorption is not affected by the rate of stirring of the gas. The rate of absorption is not affected by the rate of stirring of the solid.

The results of the investigation are as follows: The rate of absorption of the gas is not affected by the rate of stirring of the liquid. The rate of absorption is not affected by the rate of stirring of the gas. The rate of absorption is not affected by the rate of stirring of the solid.

The results of the investigation are as follows: The rate of absorption of the gas is not affected by the rate of stirring of the liquid. The rate of absorption is not affected by the rate of stirring of the gas. The rate of absorption is not affected by the rate of stirring of the solid.

The results of the investigation are as follows: The rate of absorption of the gas is not affected by the rate of stirring of the liquid. The rate of absorption is not affected by the rate of stirring of the gas. The rate of absorption is not affected by the rate of stirring of the solid.

Samples of Steels C and D before carburizing were examined under a microscope 2000x. In the fine-grained samples of Steel D the grain boundary constituents (etched dark with the nital) seemed to form networks about the light-colored grains; whereas in the other samples examined the grain boundary constituents were more discontinuous. In spheroidized samples, of course, nothing resembling grain boundary networks were observed.

epithelial tissue, at points, during the process of
necrosis was observed.

DISCUSSION

Effect of initial structure of steel on rate of carburization

In this work no exceptions were found to the statement that initial grain size affected the final grain size and rate of diffusion of carbon, when the carburizing temperature was less than 200°F. above the upper critical point (Ac3).

Nothing has been said of the austenitic grain size of the steels which were carburized. It is not believed that variations in austenitic grain size or discontinuities in the lattice structure of the metal affect the rate of carburization. Mehl, in commenting on the work of Mooradian and Norton /7/, observed that the diffusion in some binary metallic systems occurs at a rate apparently independent of the presence of grain boundaries, and recently referred to the fact that this applies as well to the iron-carbon system.¹²² It should be said that the experimental evidence rests on a limited number of observations, and there is at least one exception; thorium diffuses in tungsten much more rapidly along the grain boundaries than through the grains /8/.

However, Eostein and Rawdon /14/ observed that abnormal steels carburized at a lower rate than normal steels, the latter of course having a much larger initial grain size. Apparently they did not investigate the effect on rate of carburization of varying the grain size of one lot of steel. Rowland and Upthegrove/5/ recently determined that large initial grain size of steel accelerated the loss of carbon through surface decarburization.

An explanation of the variations in rates of diffusion described above, may be stated as follows:

[illegible]

Rate of diffusion of carbon in the austenitic grains of the alloy is more rapid than the rate of diffusion in the material at the grain boundaries. These "grain boundary constituents" are so stable that they remain effective as barriers to the diffusion of carbon about 200°F., above the critical point (Ac3).

Of course, if the material is spheroidized, it is reasonable to expect that the "barriers" will be broken up and the resistance to diffusion diminished. A statement of the composition of these "grain boundary constituents" is not absolutely necessary.

McQuaid states /23/ that inherent grain size (as evidenced by the McQuaid-Ehn grain size for instance) depends on the presence of compounds of aluminum, vanadium, etc., at grain boundaries /4/. Davey /9/ believed that carbides, nitrides, and oxides segregated in the dendritic structure of steel impede the diffusion of carbon. It will no doubt occur to the reader that the same constituents (or properties) which influence the McQuaid-Ehn grain size may possibly affect the rate of diffusion of carbon. However, there is only indirect evidence at best to support conclusions in regard to the effect of non-metallic inclusions on the structure of steels.

EFFECT OF VARYING ALLOY CONTENT OF STEEL ON RATE OF CARBURIZATION

The work of Houdremont and Schrader /13/ has been referred to. As a result of this work they listed certain elements which when added to steel in amounts up to 6% accelerated diffusion; others which retarded diffusion; and still others which had little effect on diffusion. The effect of each alloying element on final grain size was also recorded. The writer plotted the case depths against final grain sizes as obtained by Houdremont and Schrader, and observed

State of affairs of affairs in the domestic system of the
 after the war would have been of affairs in the system of
 the world economy. The world economy, however, is not
 a static system, but a dynamic system, and the system of
 affairs is not static, but dynamic.

Of course, if the system is dynamic, it is possible to
 expect that the system will be subject to all the changes in
 the system of affairs. A system of affairs is a system of
 affairs, and a system of affairs is a system of affairs.

However, since the system is dynamic, it is possible to
 the system of affairs for the system of affairs in the system of
 affairs of affairs, and the system of affairs is a system of
 affairs.

But the system of affairs is not static, and the system of
 affairs is not static, and the system of affairs is not static.
 It will no doubt occur to the reader that the system of
 affairs is not static, and the system of affairs is not static.
 The system of affairs is not static, and the system of affairs
 is not static, and the system of affairs is not static.
 The system of affairs is not static, and the system of affairs
 is not static, and the system of affairs is not static.

THE SYSTEM OF AFFAIRS IN THE SYSTEM OF AFFAIRS

The system of affairs in the system of affairs is a system of
 affairs, and the system of affairs is a system of affairs.
 The system of affairs is a system of affairs, and the system of
 affairs is a system of affairs, and the system of affairs is a
 system of affairs. The system of affairs is a system of affairs,
 and the system of affairs is a system of affairs, and the system
 of affairs is a system of affairs, and the system of affairs is a
 system of affairs, and the system of affairs is a system of affairs.

that rate of diffusion increased in a fairly regular manner as the grain size of the carburized specimens increased. In most cases it did not seem to matter greatly which alloying element was present. Aluminum and chromium were conspicuous exceptions. Each one decreased the rate of diffusion and increased the grain size. The information available was insufficient to attempt a correlation of rate of diffusion with initial grain size.


In the opinion of the writer, a more complete understanding of the effect of alloying additions on rate of diffusion would result if these additions were studied from the point of view of their effect on the grain size of the steel.

ACKNOWLEDGEMENT

The writer desires to express his appreciation of the cooperation of the Allegheny Steel Company, the Carnegie-Illinois Steel Corporation, the Inspector of Naval Material at Munhall, Penna., the Republic Steel Corporation, and the Midvale Company, in furnishing samples required for test, and performing chemical analyses; and of the personnel of the Metals Research Laboratory and Department of Metallurgy, Carnegie Institute of Technology, for valuable advice and suggestions.

It was pointed out that the above information was not
given to the Commission in the report of the Commission
on the subject of the above information.

The office of the Secretary of the Board of
 Directors of the American Telephone and Telegraph
 Company, New York, N. Y., is hereby notified
 that the undersigned has been appointed
 Secretary of the Board of Directors of the
 American Telephone and Telegraph Company, New
 York, N. Y., and will act as such from and
 after the date of his appointment.

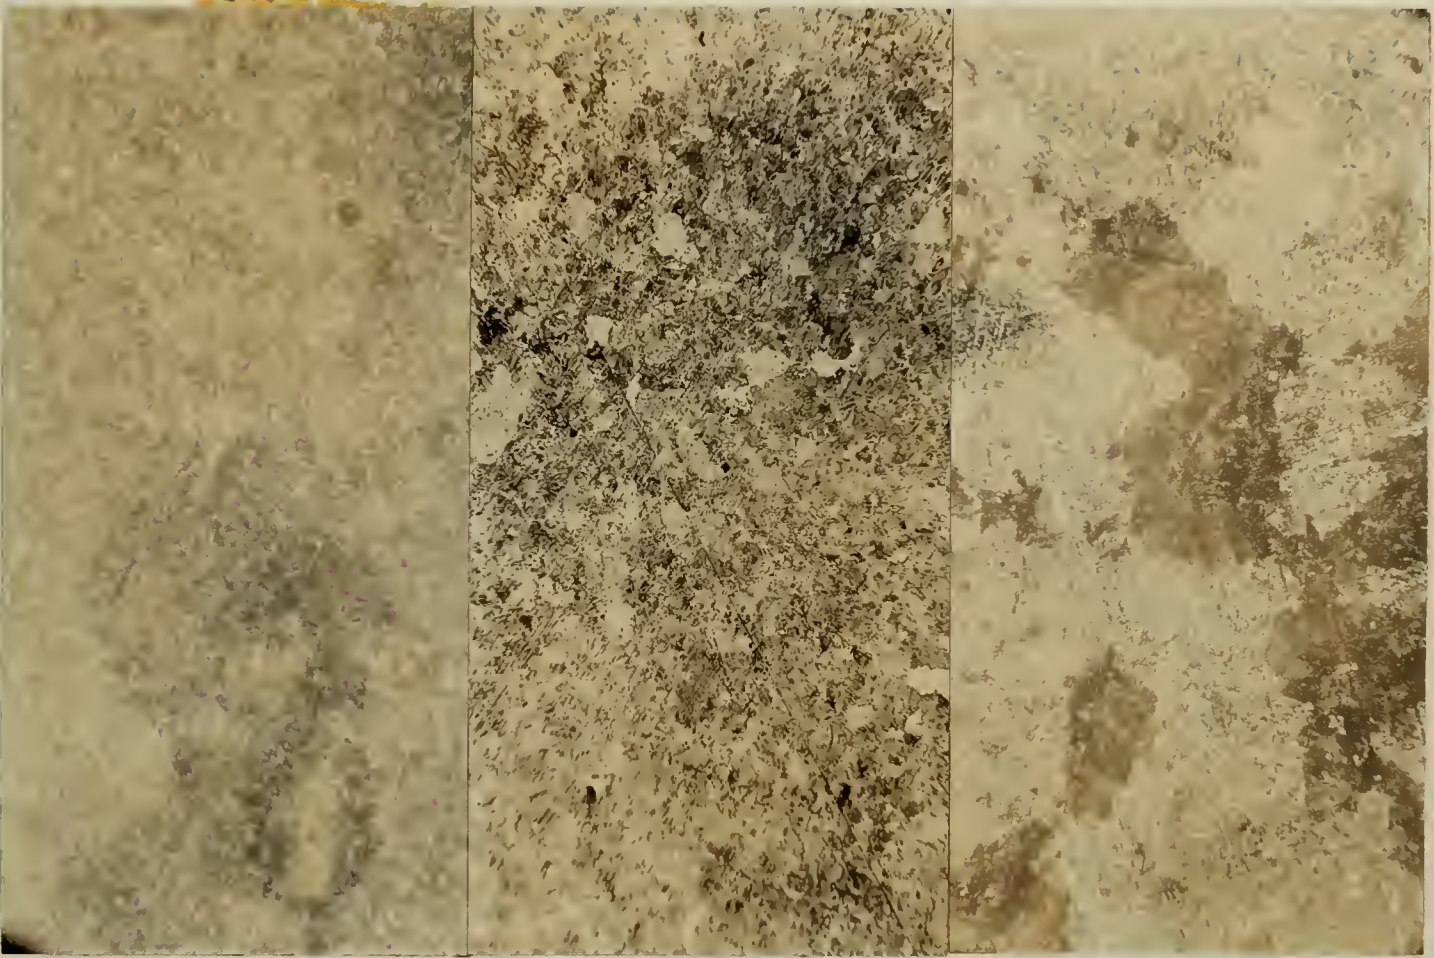

a
Annealed from 1600
Steel C

b
Annealed from 1850

c
Annealed from 2100F

Figure 1..

Magnification 100 X




50000 1000 10000

10000 1000 10000

10000 1000 10000

10000 1000 10000

10000 1000 10000

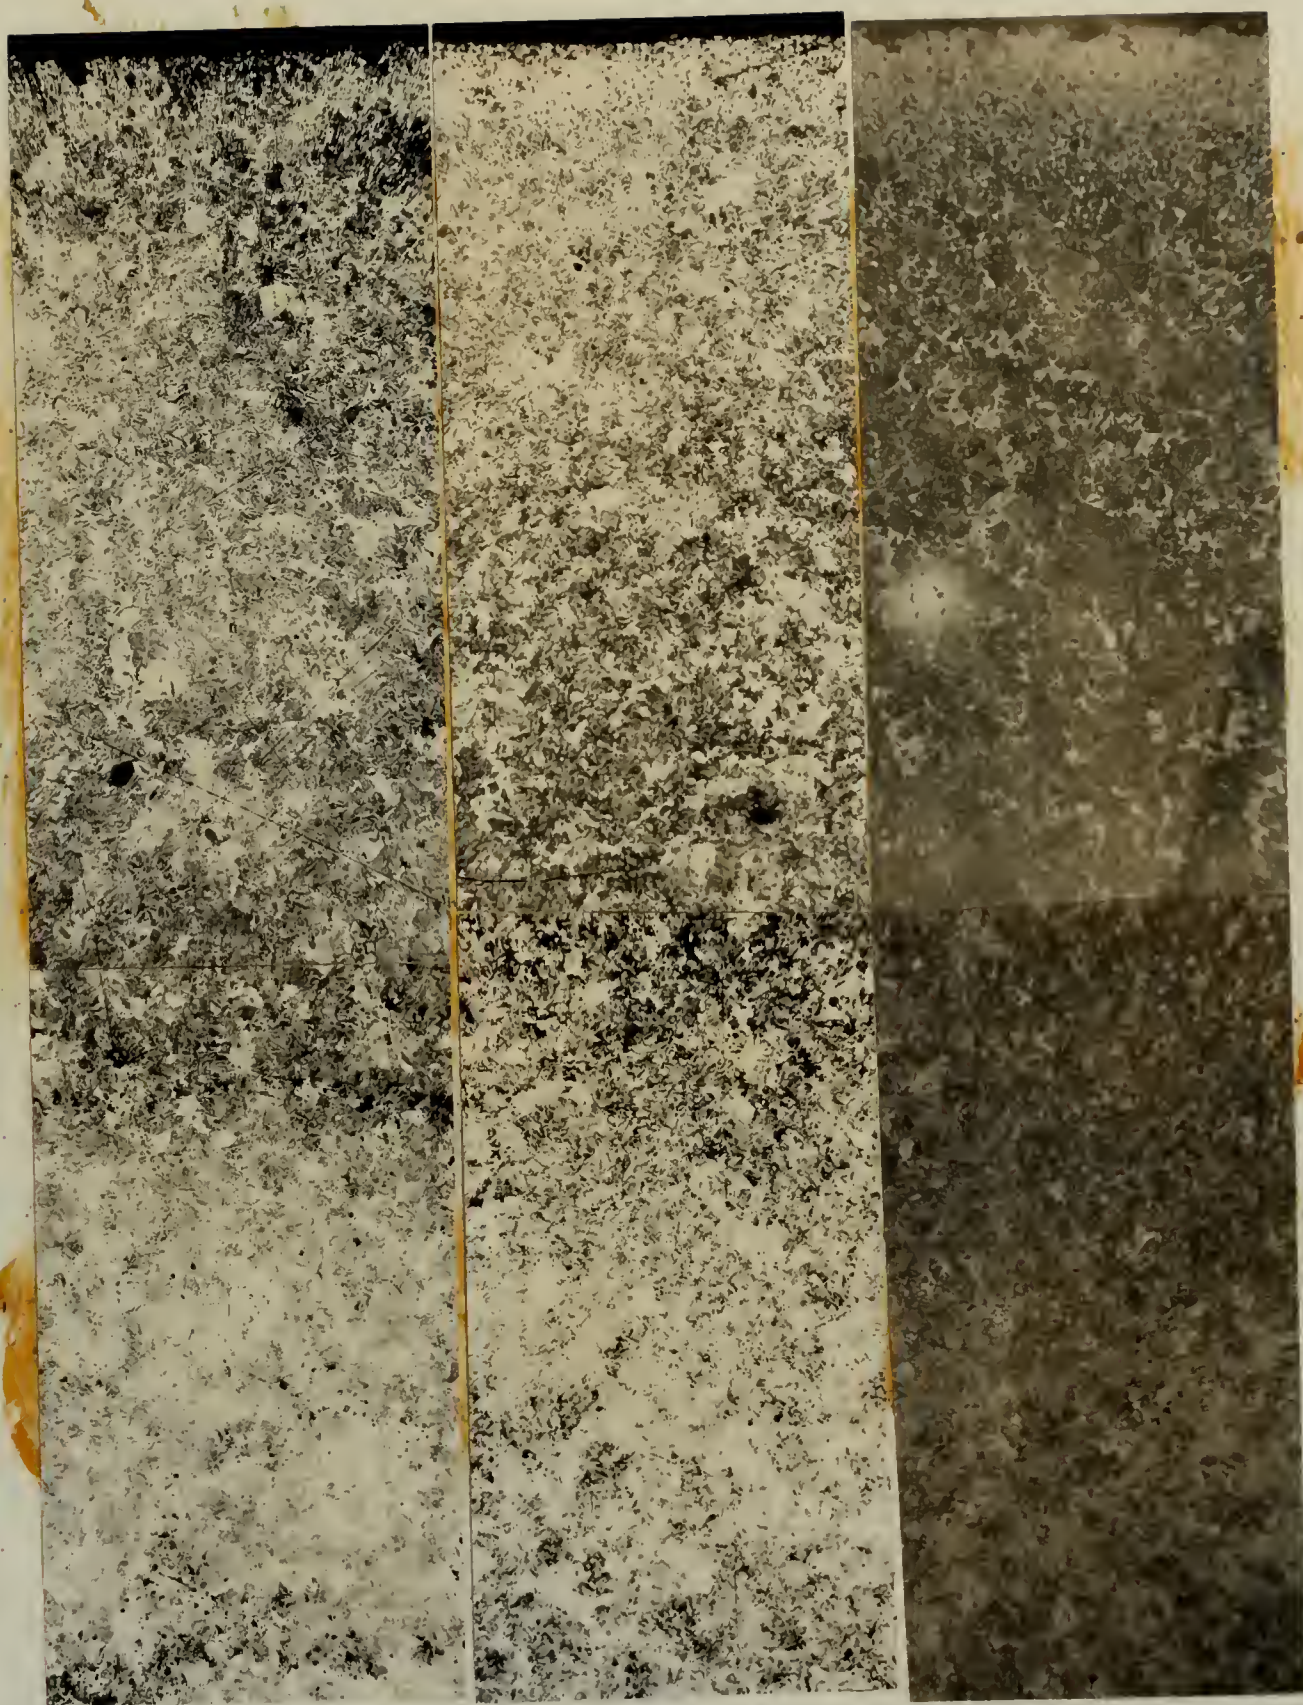

a
At 1600 At 1600

b
At 1850


c
At 2100° F.

Annealed prior to carburizing at temperatures indicated. Carburized at 1615° F. for 12 hours. Steel C.

Figure 2.
Magnification 100X



THE UNIVERSITY OF CHICAGO
LIBRARY
540 EAST 58TH STREET
CHICAGO, ILL. 60637
TEL. 733-4100
FAX 733-4100

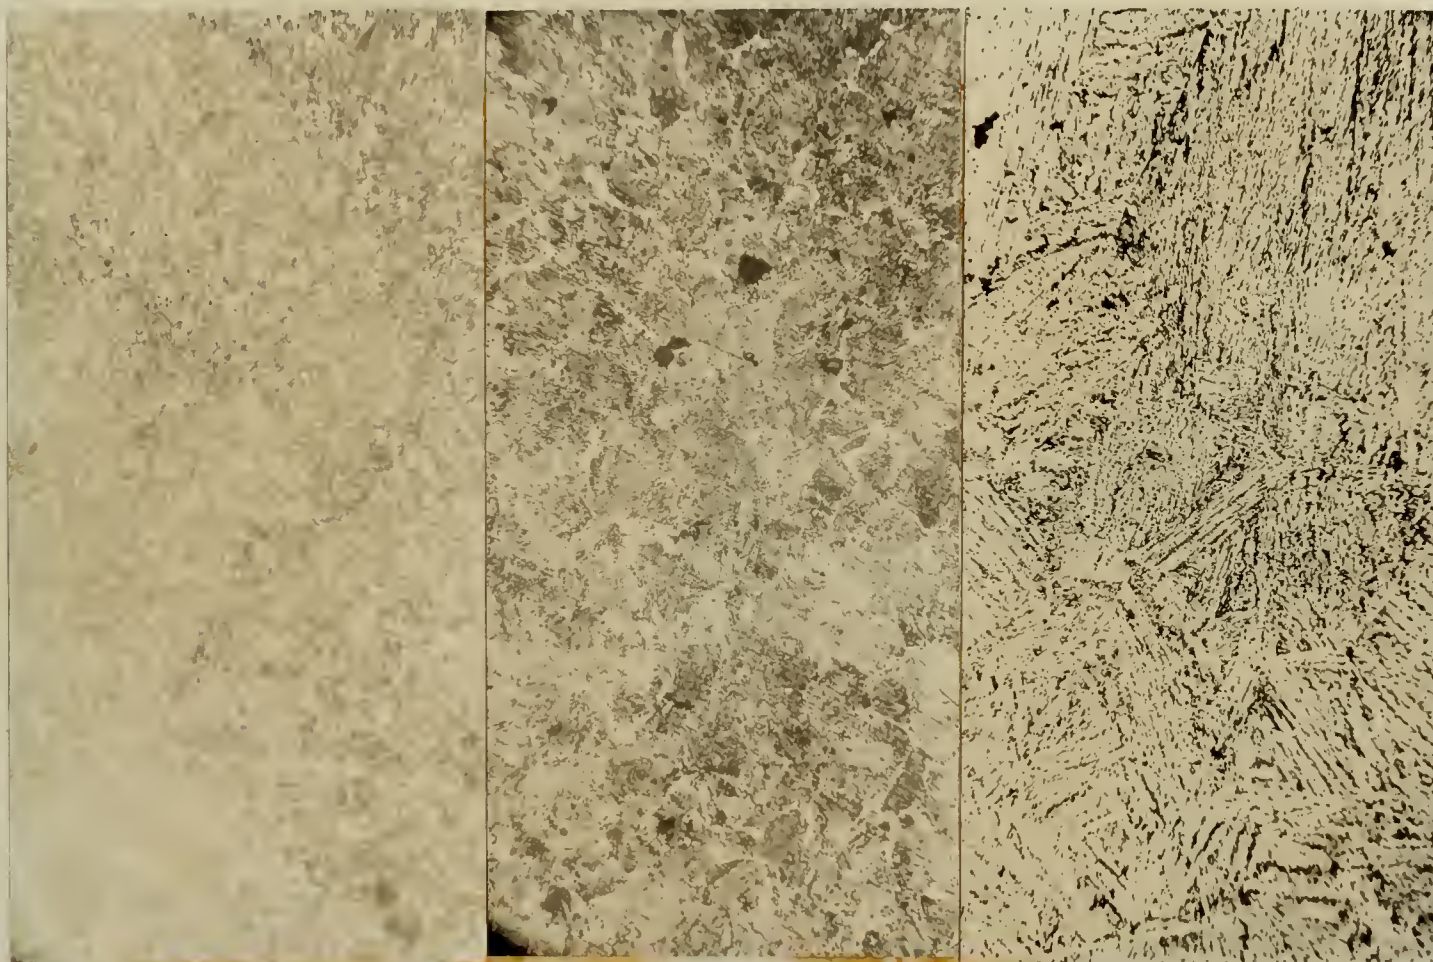

^a Annealed from 1600 ^b Annealed from 1850 ^c Annealed from 2100° F.
 Steel D


Figure 3. .

Magnification 100 X



Unreel 1700 1000 Unreel 1700 1000
Unreel 1700 1000 Unreel 1700 1000
Unreel 1700 1000 Unreel 1700 1000

Unreel 1700 1000

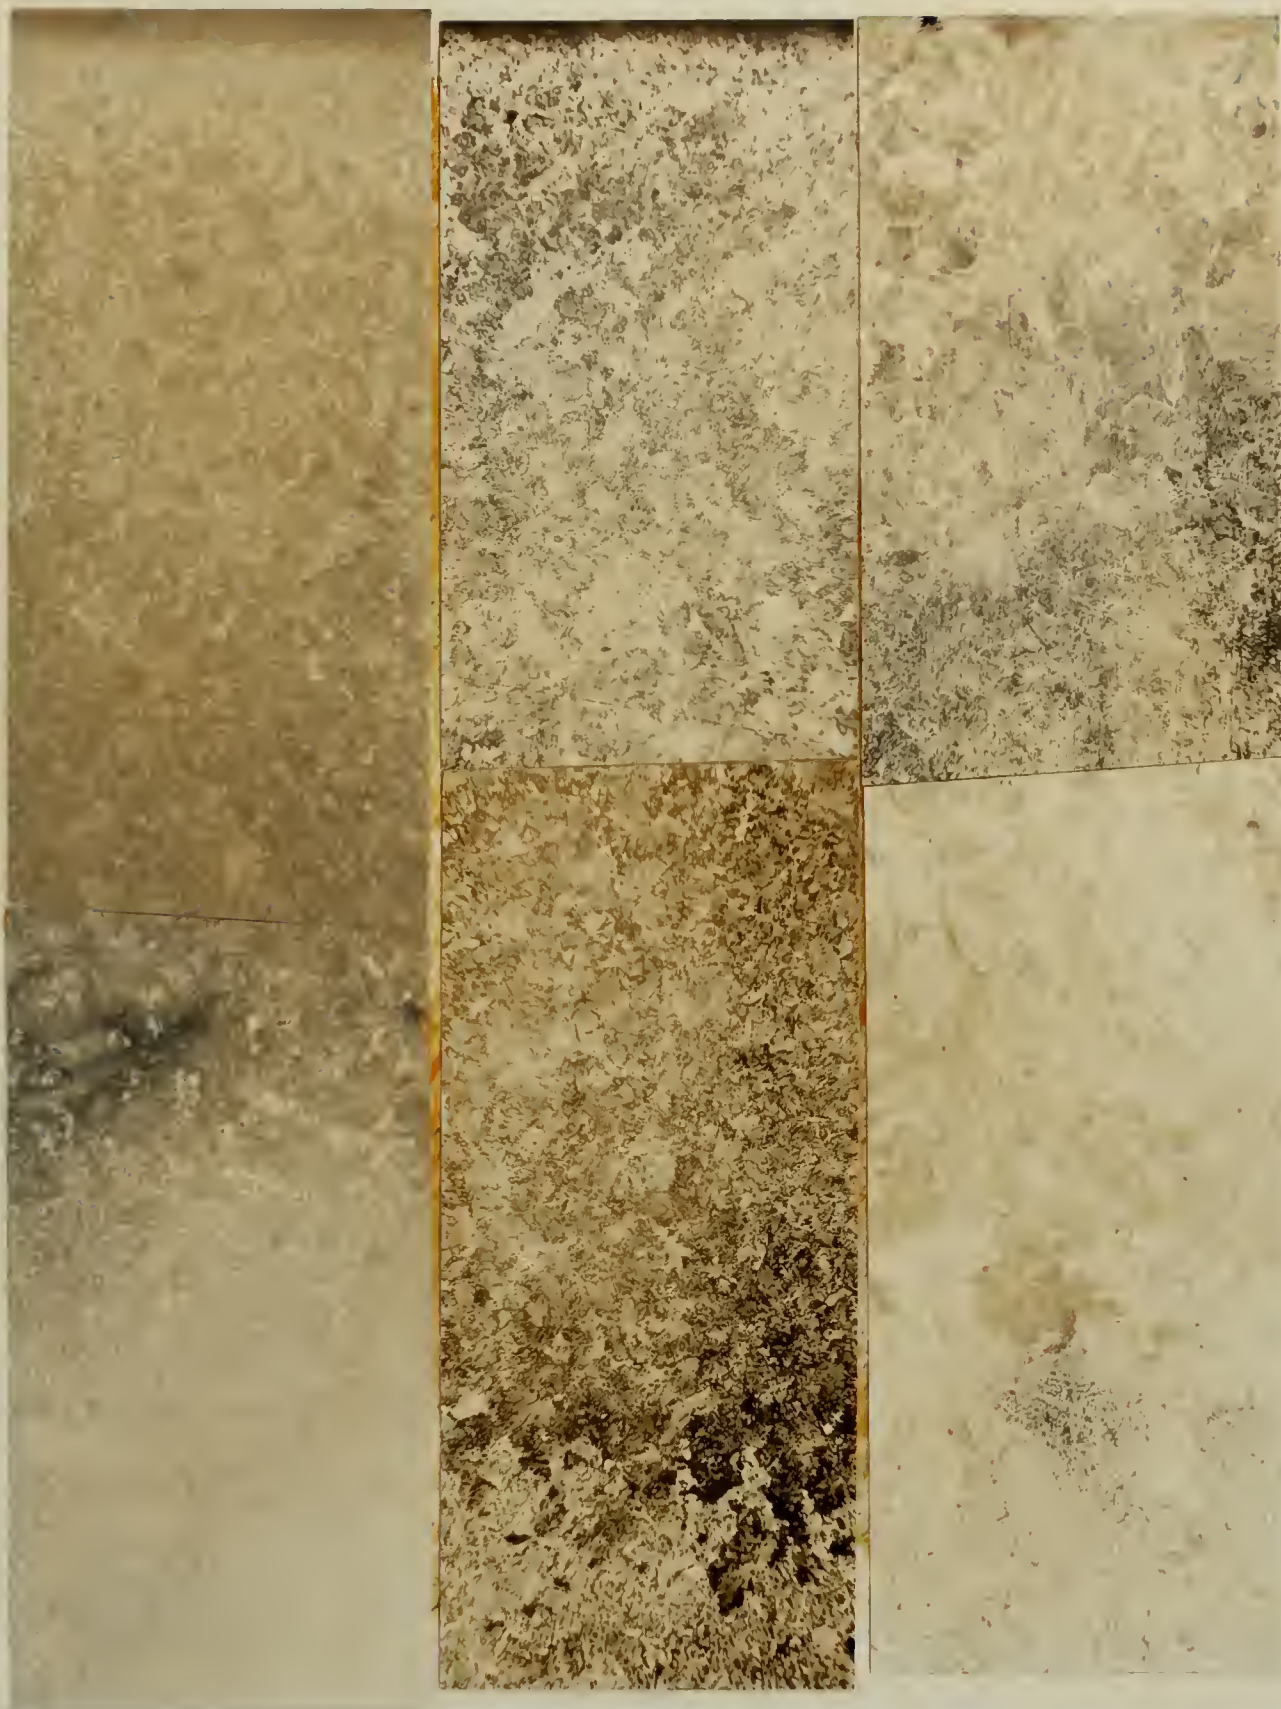

^a Annealed from 1600 ^b Annealed from 1850 ^c Annealed from 2100° F.
 Heat treatment prior to carburizing as indicated. Carburized at 1615° F.
 Steel D.


Figure 4..

Magnification 100 X




THESE PAGES ARE TO BE KEPT IN THE
FILE OF THE CASE AND NOT
RETURNED TO THE PARTY
WHICH THEY BELONG TO.

RECEIVED BY THE
COURT

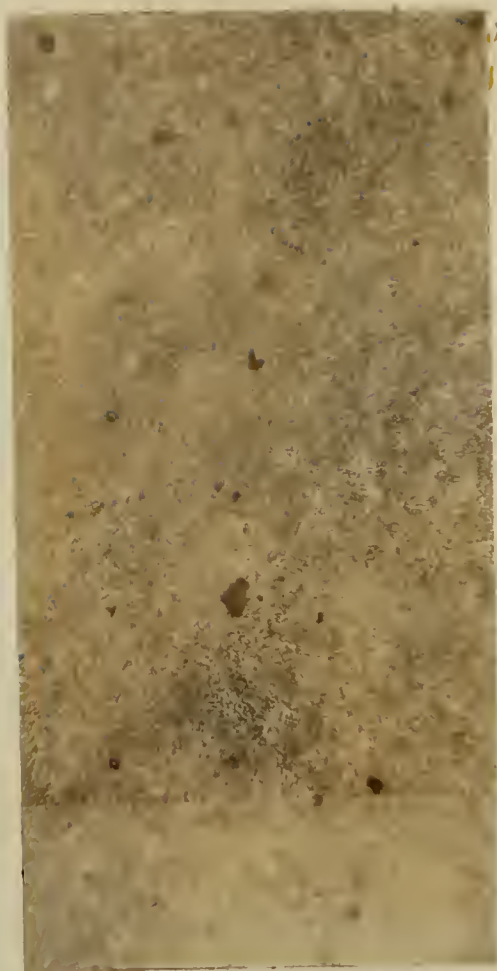

C 4

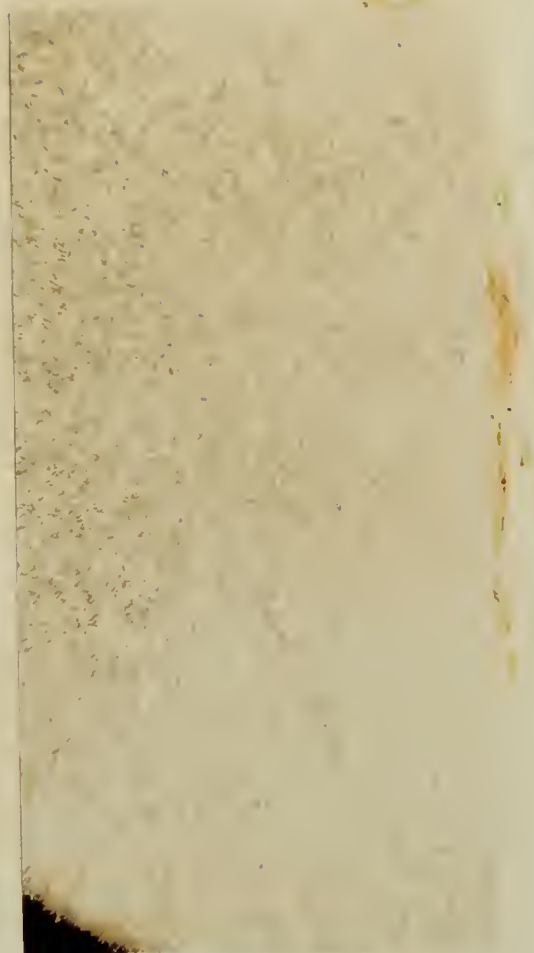

D 4

Figure 5..

Magnification 100 X




10

11

12

13

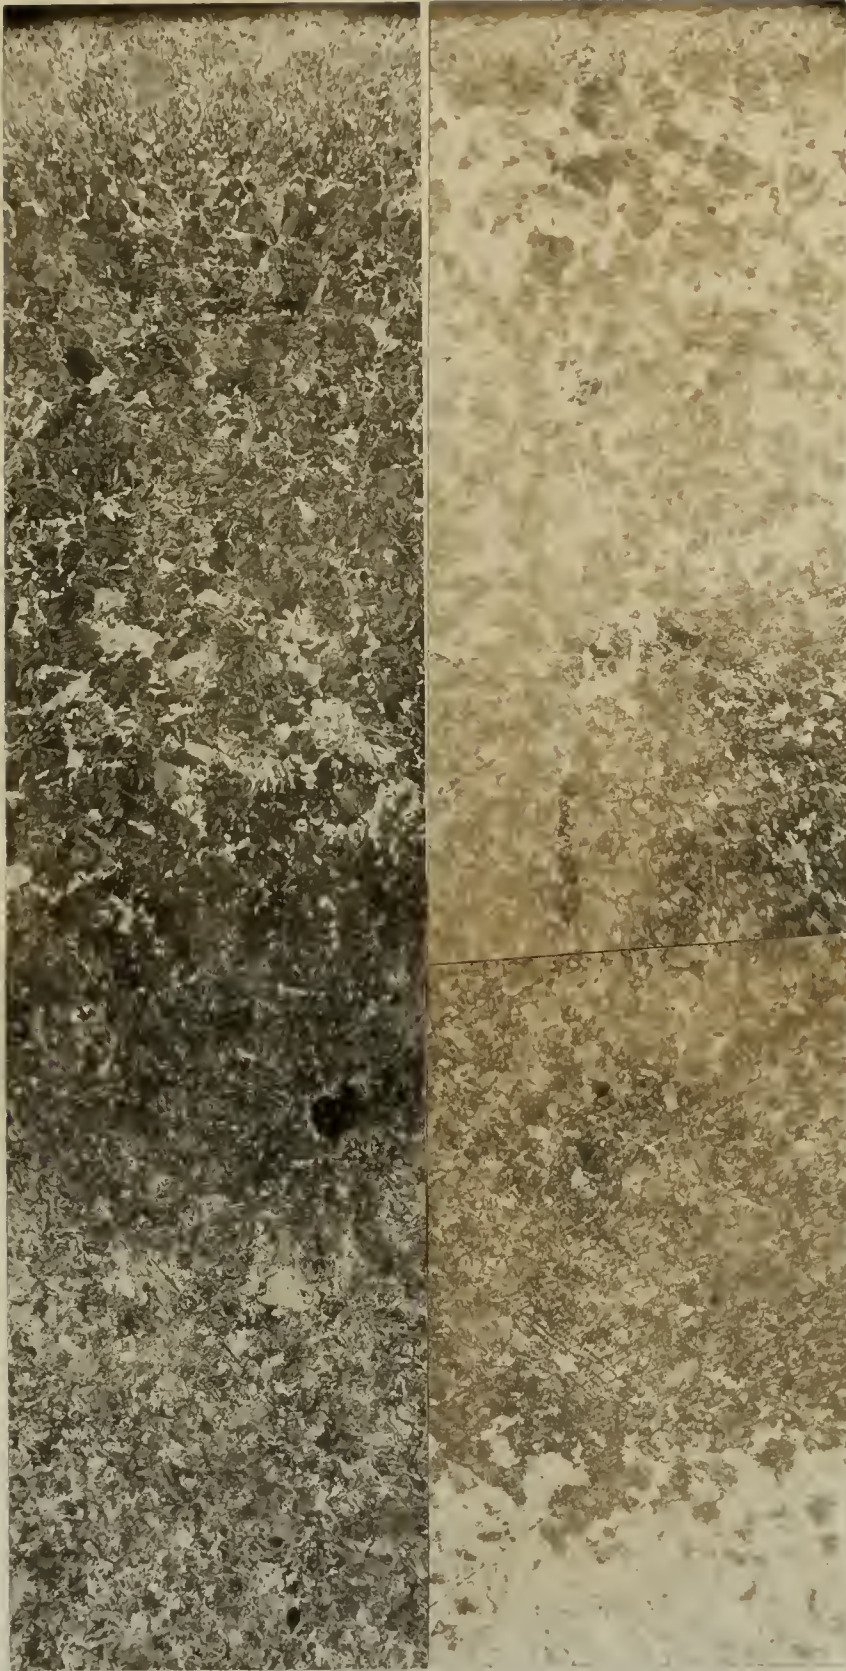

a

b

Steel C

Steel D

Annealed prior to carburizing at 1300 F. for Carburized at
1615 for 12 hrs

Figure
Magnification 100X




6

Sheet 10

THE UNIVERSITY OF CHICAGO PRESS
CHICAGO, ILL. 60637

1960-61

100-100000-1000

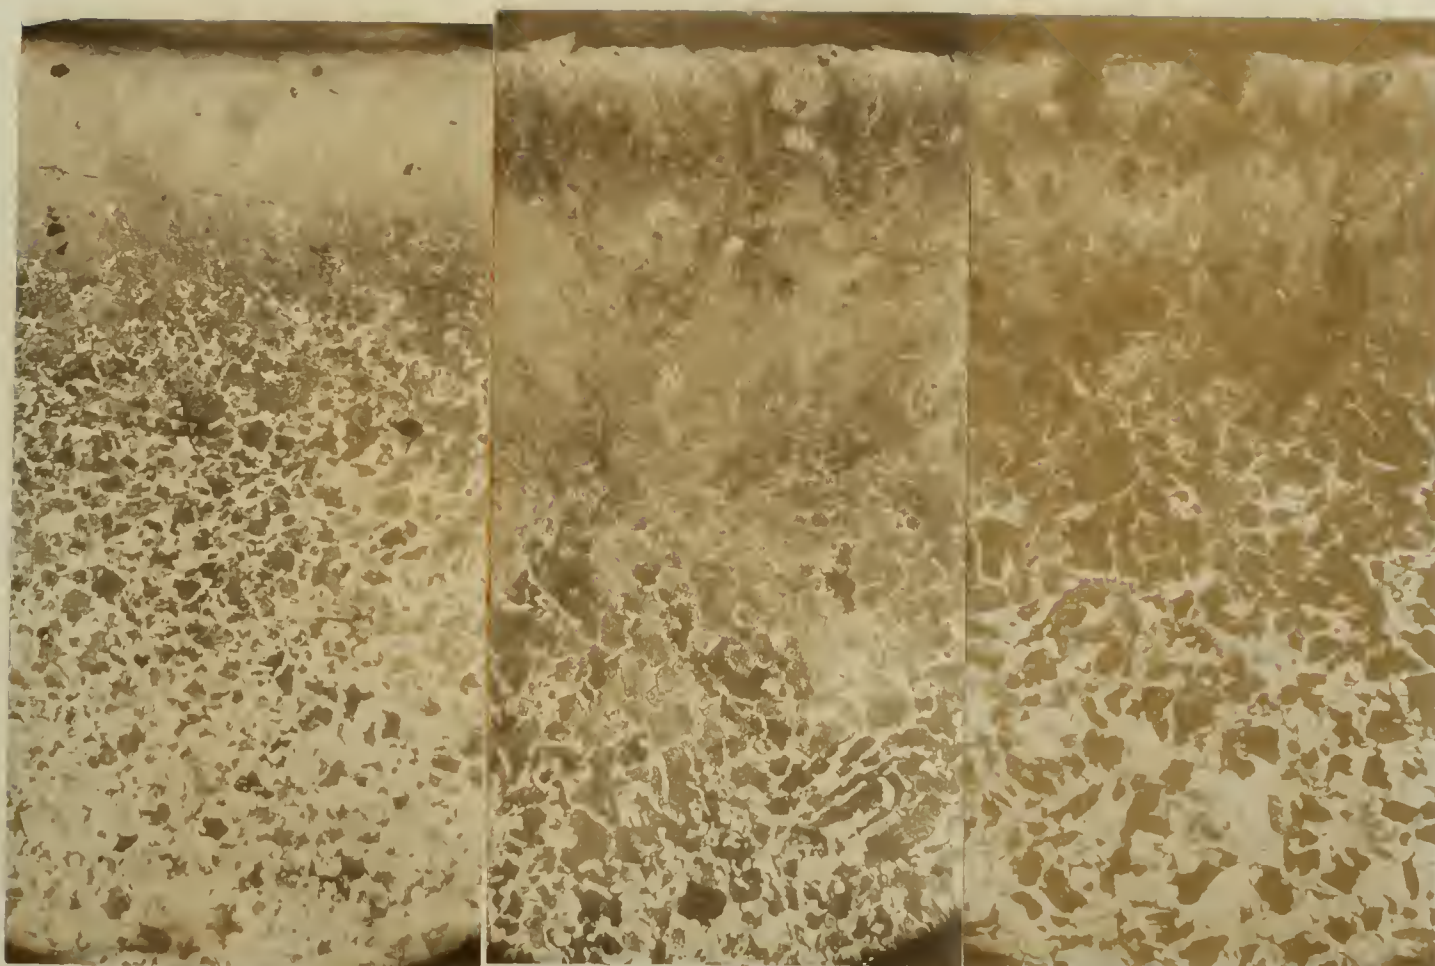

a
Annealed from 1800 F

b
Annealed from 2100 F

c
Annealed from 2100 F
Heavily decarburized in
heat treating.

Treatment prior to carburizing as indicated. Carburized at 1635 F for 12 hours. Steel A.

Figure 7.

Magnification 100 X




THESE ARE THE RESULTS OF THE ANALYSIS OF THE SAMPLES OF THE
SUBSTANCE WHICH WAS OBTAINED FROM THE ANALYSIS OF THE
SUBSTANCE WHICH WAS OBTAINED FROM THE ANALYSIS OF THE

ANALYSIS OF THE SUBSTANCE WHICH WAS OBTAINED FROM THE ANALYSIS OF THE
SUBSTANCE WHICH WAS OBTAINED FROM THE ANALYSIS OF THE

TABLE 1.

THESE ARE THE RESULTS OF THE ANALYSIS OF THE

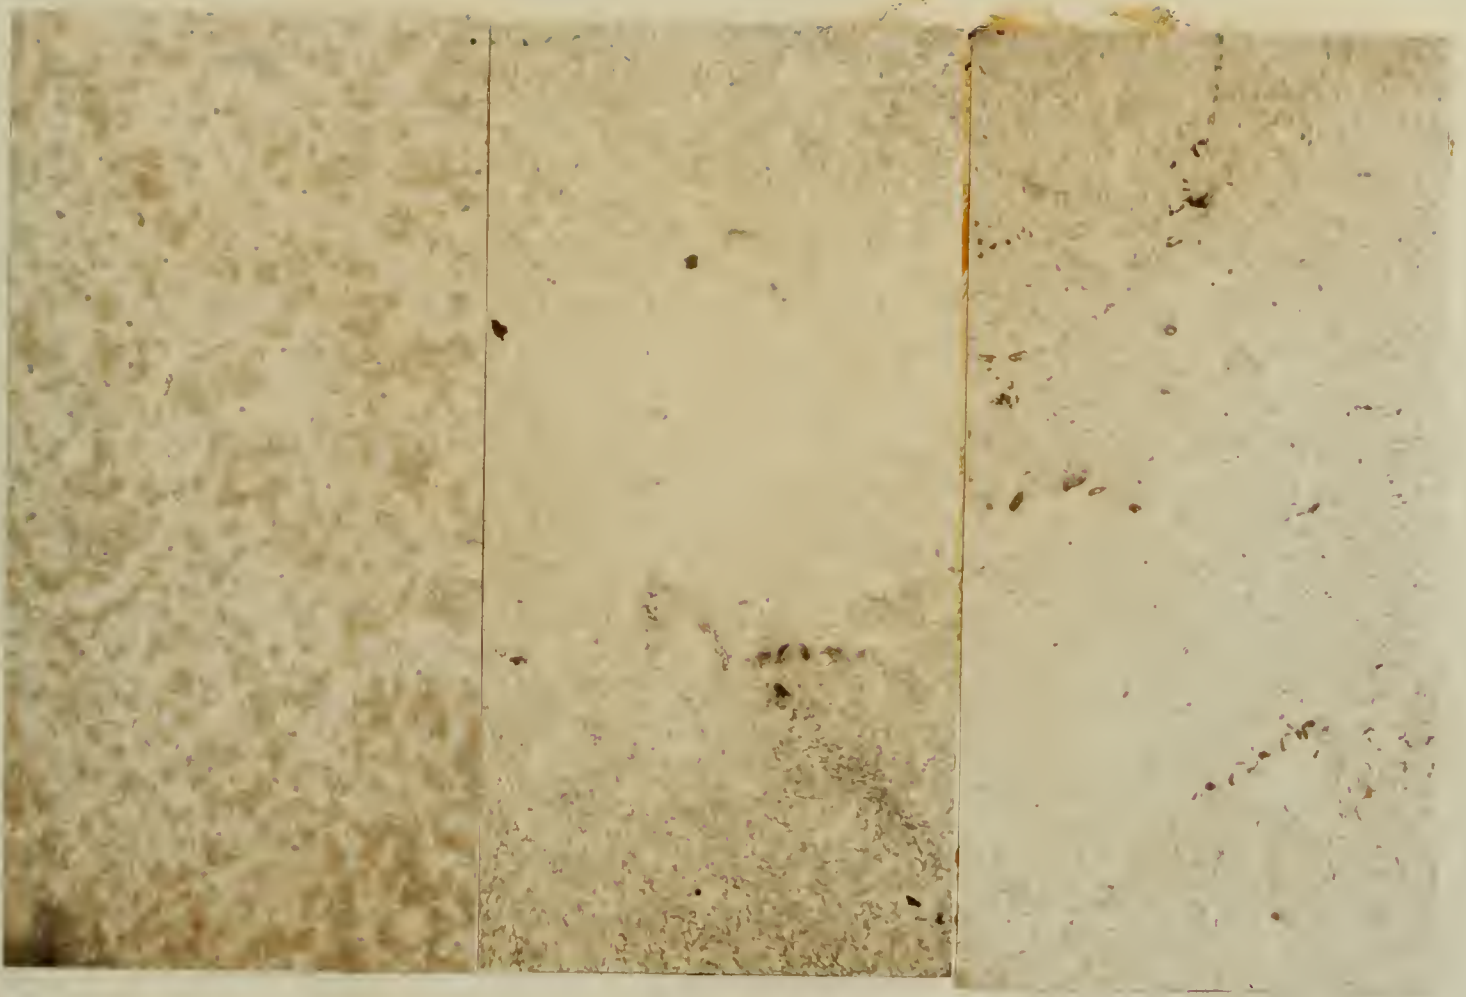

a
B 1

(Poo)

b
B 2

(B4 or 6)

c
B 3

B 12

Figure 8

Magnification 100 X




u
B I
(300)

1
B I
(300)


c
B I
(300)

8 7 17

X 001 301/171

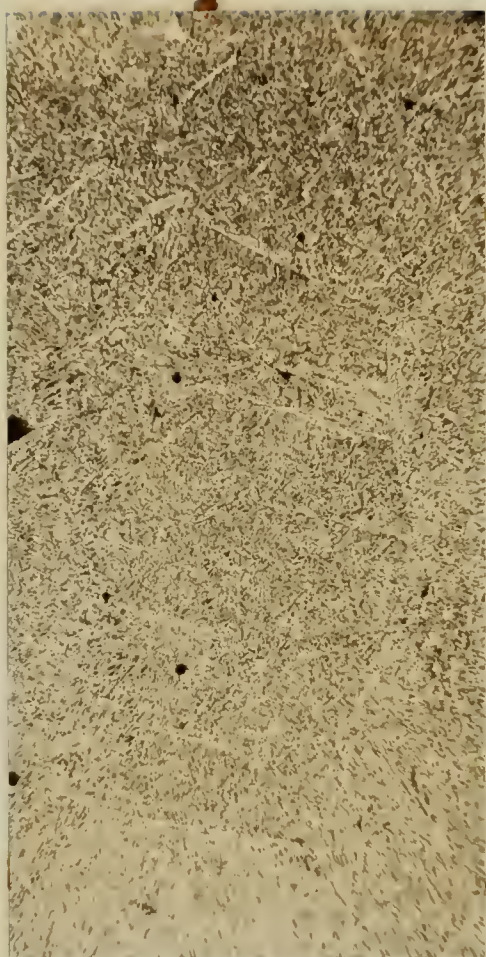

a
B4
(77)

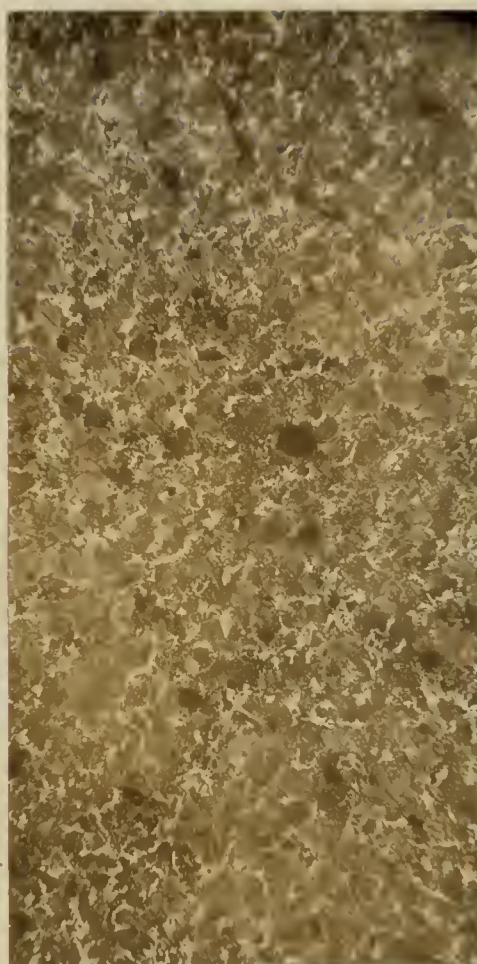

b
E1

Figure 9

Magnification 100 X



Steel A
Annealed at 2100° F.
Figure 10



Steel &
enclosed at 2100 P.
Figure 10

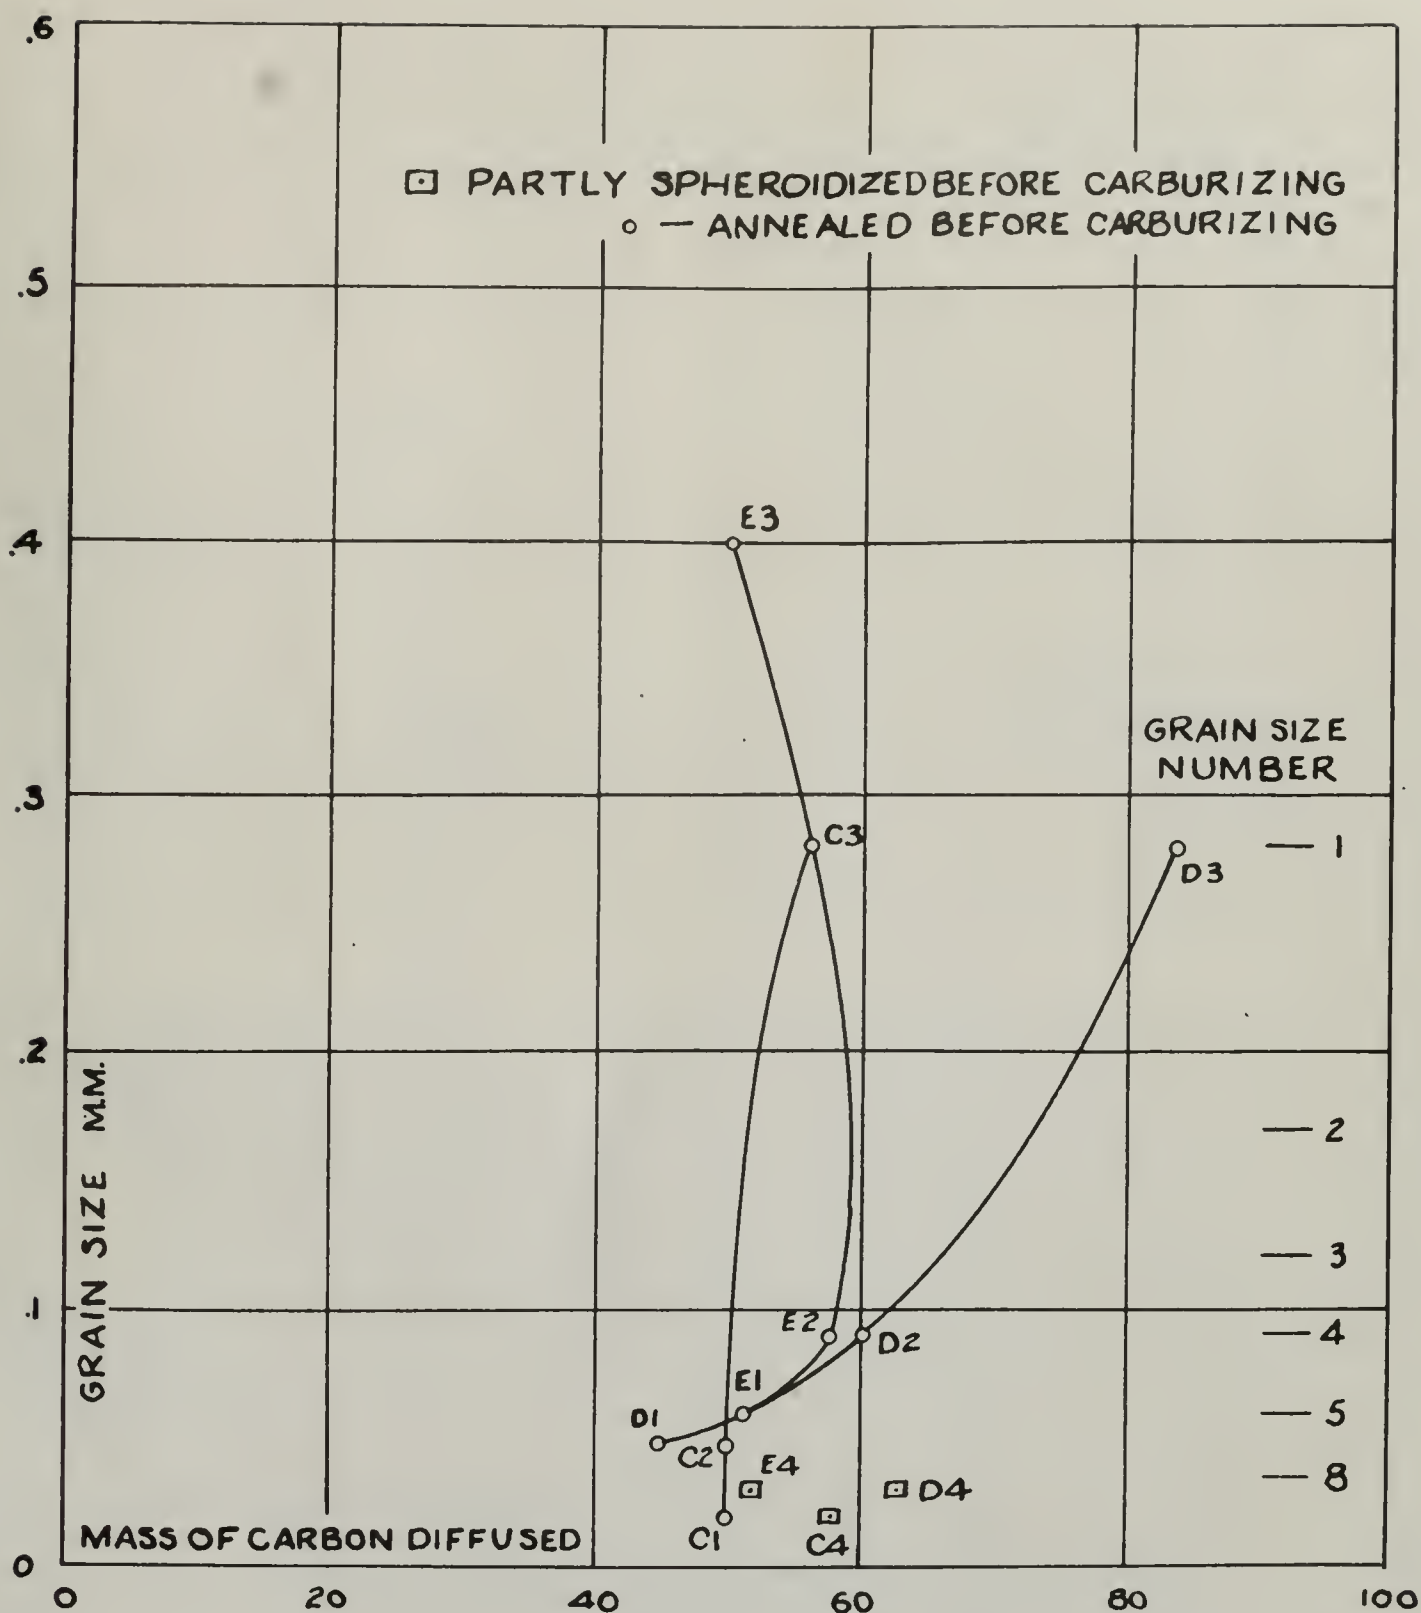


FIGURE II

COMPARISON OF MASS OF CARBON
DIFFUSED FOR VARIOUS SAMPLES
STEEL C, D, AND G

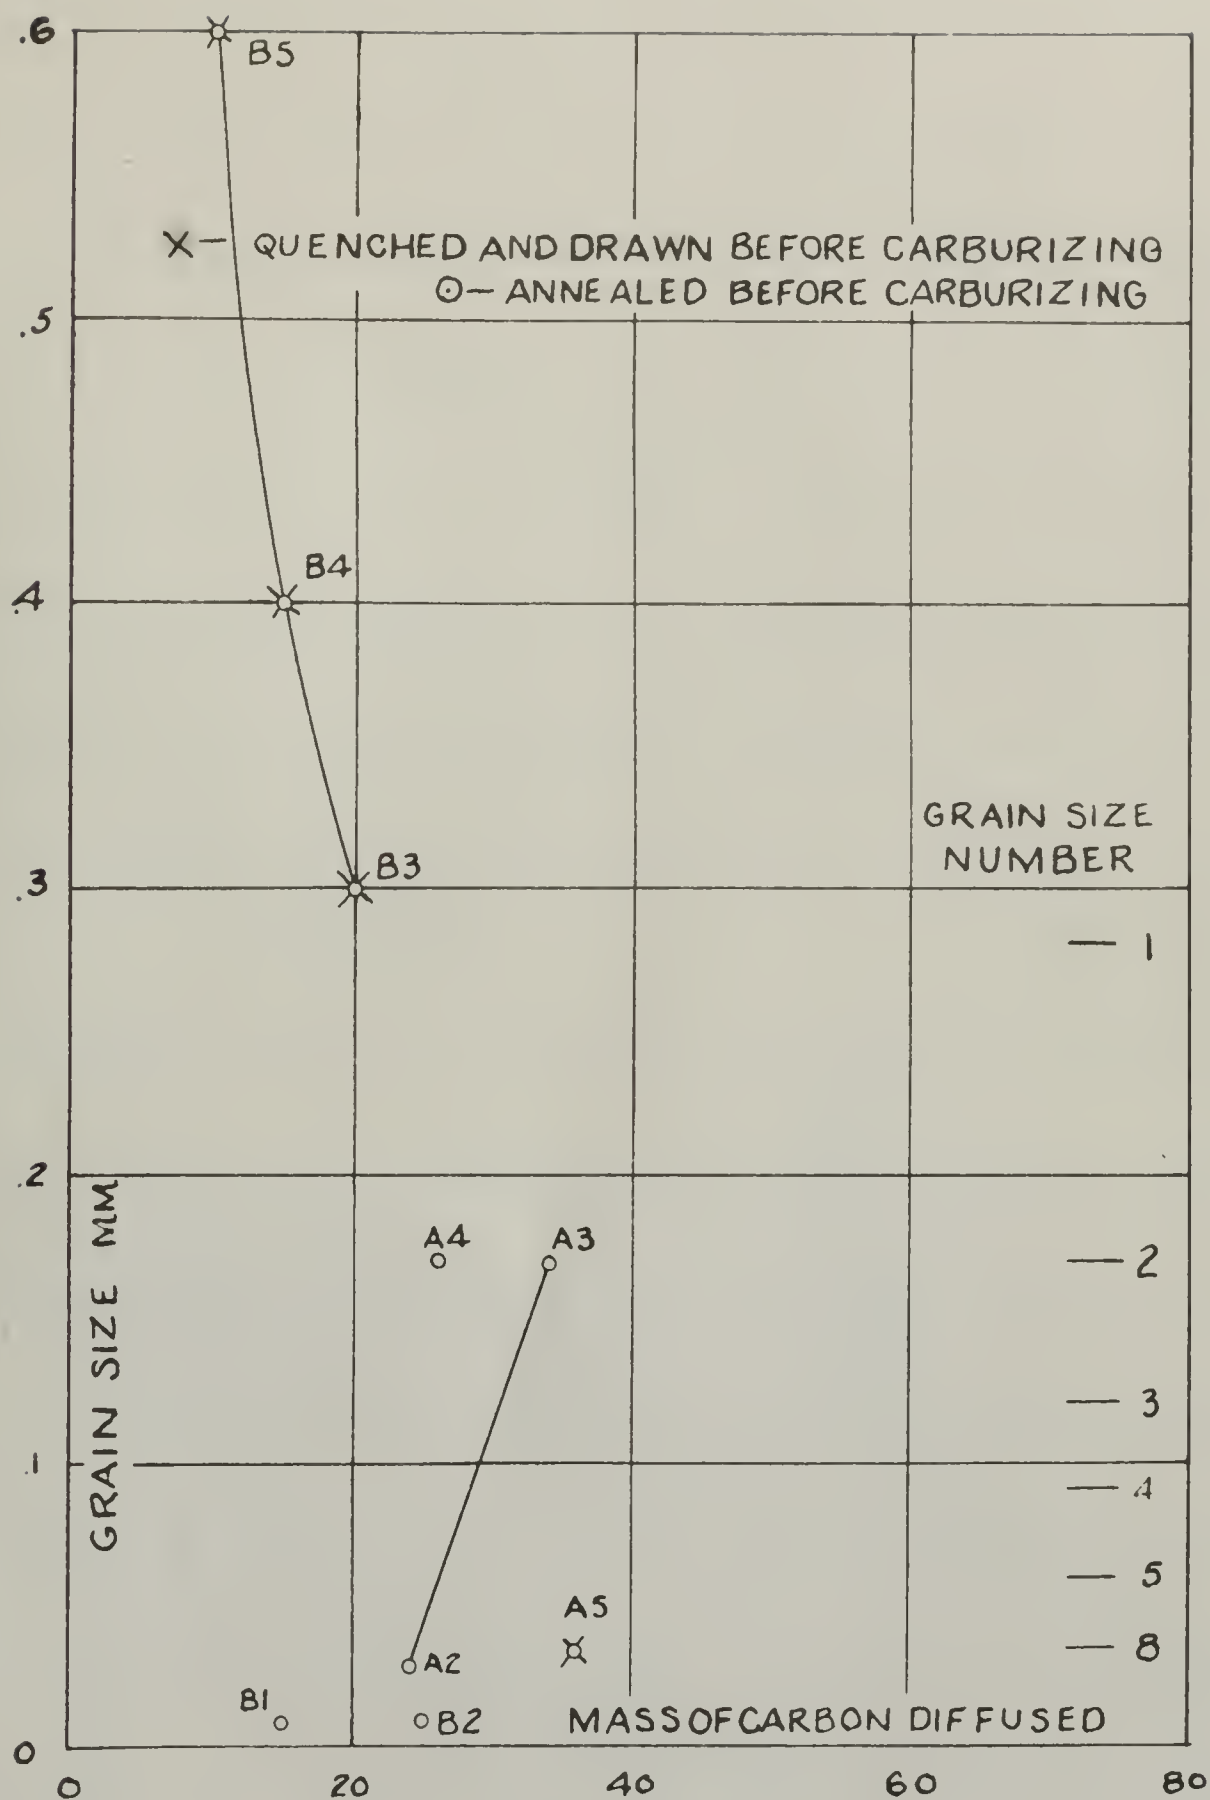


FIGURE 12

COMPARISON OF MASS OF CARBON
DIFFUSED FOR VARIOUS SAMPLES
STEEL A AND B

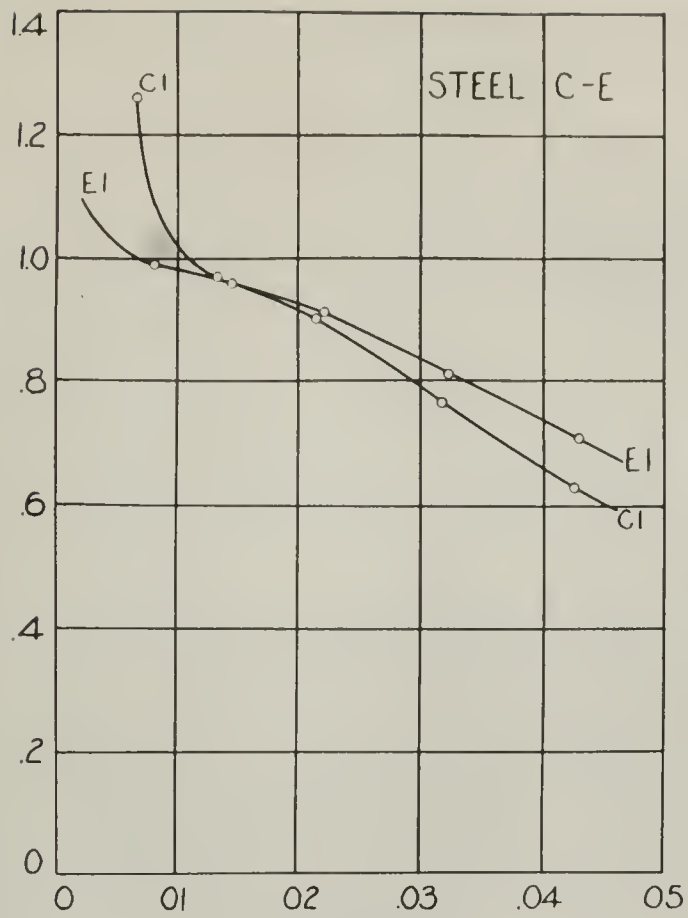


FIGURE 13

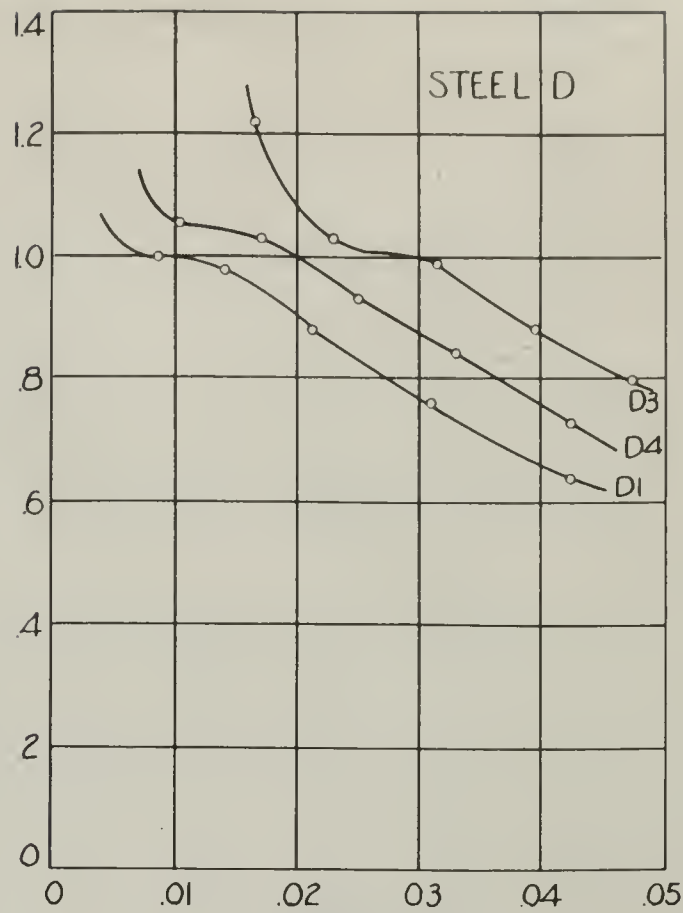


FIGURE 14

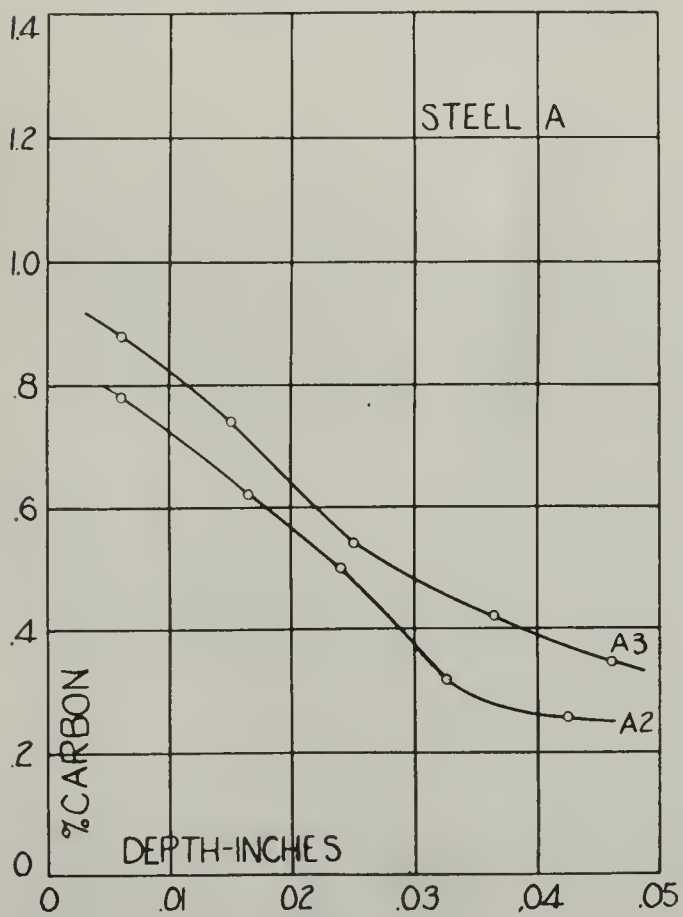


FIGURE 15

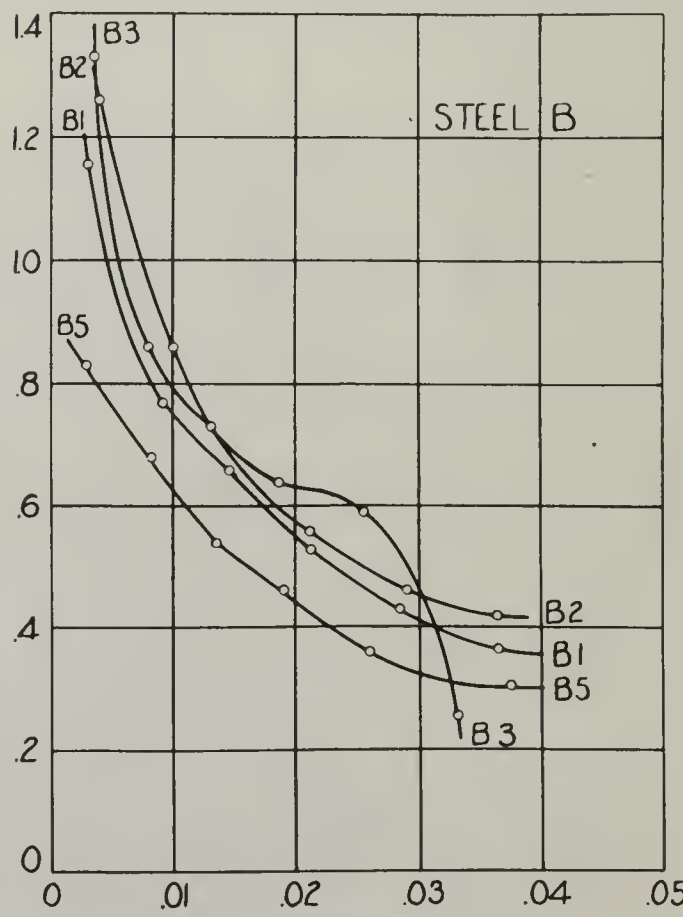


FIGURE 16

CARBON PENETRATION CURVES
CARBON CONCENTRATION PLOTTED AGAINST DEPTH

Table I.

Compositions of steels under test.
Sample no. SAE no.

		Carbon %	Manganese %	Nickel %	Chromium %	Molybdenum %
A	1020	0.24	0.56		-	-
B	3335	0.34	0.33	3.79	1.72	-
C	3335	0.355	0.48	3.41	1.45	-
D	4335	0.37	0.73	1.75	0.73	0.37
E	3435	0.415	0.47	2.95	0.76	-

T of the

Source	Latitude	Longitude	Altitude	Time	Remarks
1	34.0	118.0	1000	10.00	Clear
2	34.0	118.0	1000	10.05	Clear
3	34.0	118.0	1000	10.10	Clear
4	34.0	118.0	1000	10.15	Clear
5	34.0	118.0	1000	10.20	Clear
6	34.0	118.0	1000	10.25	Clear
7	34.0	118.0	1000	10.30	Clear
8	34.0	118.0	1000	10.35	Clear
9	34.0	118.0	1000	10.40	Clear
10	34.0	118.0	1000	10.45	Clear

Table II.

Histories of individual samples.				Relative mass of carbon diffused during carb.	
Sample no.	Heat to of	Preliminary treatment	Manner of cooling	Grain size before carburizing mm.	No. 8
A1	1800	3	box cooled	0.02	8
A2	1800	3	"	0.03	7
A3	2100	3	"	0.17	2
A4	2100	20	" (oxidized)	0.17	2
A5	1800	2	water quenched	-	-
A6	2100	2	"	-	-
				(estimated by appearance)	
				24.	24.2
					34.4
					27.2
					36.6
					35
B1	as received,	drawn at 1200 $\frac{1}{2}$ hr.			
B2	1630	2	cooled in sand	0.01	8
B3	2450	10 and		0.01	8
B4	2150	1	box cooled	0.3	1
B5	2450	10 and			
B6	1850	2	box cooled	0.4	1
	2500	1	box cooled	0.6	1
	2100	1	air cooled	0.2	2
				(blued spot after carb.)	
C1	1600	2	furnace cooled	0.02	8
C2	1850	2	"	0.05	6
C3	2100	2	"	0.28	1
C4	1300	22	"	0.02	8
D1	1600	2	"	0.05	6
D2	1850	2	"	0.09	4
D3	2100	2	"	0.28	1
D4	1300	22	"	0.03	7
E1	1600	2	"	0.06	5
E2	1850	2	"	0.09	4
E3	2100	2	"	0.4	1
E4	1300	22	"	0.03	7
				(blued spot after carb.)	
				52.0	52.0
				57.9	57.9
				49.5	49.5
				51.3	51.3

II effect

selfness furnished by absolute
transcendental perfection of a friend

To whom referred		To whom referred		To whom referred		To whom referred	
Beneficial action		Beneficial action		Beneficial action		Beneficial action	
(Beneficial action)		(Beneficial action)		(Beneficial action)		(Beneficial action)	
1.00	10.0	1.00	10.0	1.00	10.0	1.00	10.0
2.00	20.0	2.00	20.0	2.00	20.0	2.00	20.0
3.00	30.0	3.00	30.0	3.00	30.0	3.00	30.0
4.00	40.0	4.00	40.0	4.00	40.0	4.00	40.0
5.00	50.0	5.00	50.0	5.00	50.0	5.00	50.0
6.00	60.0	6.00	60.0	6.00	60.0	6.00	60.0
7.00	70.0	7.00	70.0	7.00	70.0	7.00	70.0
8.00	80.0	8.00	80.0	8.00	80.0	8.00	80.0
9.00	90.0	9.00	90.0	9.00	90.0	9.00	90.0
10.00	100.0	10.00	100.0	10.00	100.0	10.00	100.0

To whom referred		To whom referred		To whom referred		To whom referred	
Beneficial action		Beneficial action		Beneficial action		Beneficial action	
(Beneficial action)		(Beneficial action)		(Beneficial action)		(Beneficial action)	
1.00	10.0	1.00	10.0	1.00	10.0	1.00	10.0
2.00	20.0	2.00	20.0	2.00	20.0	2.00	20.0
3.00	30.0	3.00	30.0	3.00	30.0	3.00	30.0
4.00	40.0	4.00	40.0	4.00	40.0	4.00	40.0
5.00	50.0	5.00	50.0	5.00	50.0	5.00	50.0
6.00	60.0	6.00	60.0	6.00	60.0	6.00	60.0
7.00	70.0	7.00	70.0	7.00	70.0	7.00	70.0
8.00	80.0	8.00	80.0	8.00	80.0	8.00	80.0
9.00	90.0	9.00	90.0	9.00	90.0	9.00	90.0
10.00	100.0	10.00	100.0	10.00	100.0	10.00	100.0

To whom referred		To whom referred		To whom referred		To whom referred	
Beneficial action		Beneficial action		Beneficial action		Beneficial action	
(Beneficial action)		(Beneficial action)		(Beneficial action)		(Beneficial action)	
1.00	10.0	1.00	10.0	1.00	10.0	1.00	10.0
2.00	20.0	2.00	20.0	2.00	20.0	2.00	20.0
3.00	30.0	3.00	30.0	3.00	30.0	3.00	30.0
4.00	40.0	4.00	40.0	4.00	40.0	4.00	40.0
5.00	50.0	5.00	50.0	5.00	50.0	5.00	50.0
6.00	60.0	6.00	60.0	6.00	60.0	6.00	60.0
7.00	70.0	7.00	70.0	7.00	70.0	7.00	70.0
8.00	80.0	8.00	80.0	8.00	80.0	8.00	80.0
9.00	90.0	9.00	90.0	9.00	90.0	9.00	90.0
10.00	100.0	10.00	100.0	10.00	100.0	10.00	100.0

Table III.

Data on steels under test			Carbon percentage of Futectoid %	Carburizing Temp. of	Time hrs.	Difference between Ac3 and carb. temperature	Effect of initial grain size
Steel no.	Critical Ac3	points Ac1					
A	1575	1337	0.82	1635	12	60	yes
B	1350	1345	0.47	1465	"	115	yes
C	1350	1345	0.50	1615	"	265	none
D	1450	1360	0.61	1615	"	165	yes
E	1360	1320	0.60	1615	"	255	none

Table IV

Averaged results of carburizing tests.			Remarks.
Samples	Relative mass of carbon diffused #		
A	(all) 30.6		Similar composition Steels C,D,E - carburized at one time
B	" 16.8		
C	" 53.0		
D	" 63.0		
E	" 52.7		
C1 D1 E1	53.9		Similar treatment
C2 D2 E2	61.6		
C3 D3 E3	73.2		
C4 D4 E4	61.7		

To convert relative mass of carbon to absolute mass in pound per square inch of exposed surface, multiply by 5.9x.513

1000

only 6000. I would like
to share pictures with

三

[illegible]

1967 1968 1969 1970 1971 1972 1973 1974 1975 1976 1977 1978 1979 1980 1981 1982 1983 1984 1985 1986 1987 1988 1989 1990 1991 1992 1993 1994 1995 1996 1997 1998 1999 2000 2001 2002 2003 2004 2005 2006 2007 2008 2009 2010 2011 2012 2013 2014 2015 2016 2017 2018 2019 2020 2021 2022 2023 2024 2025 2026 2027 2028 2029 2030 2031 2032 2033 2034 2035 2036 2037 2038 2039 2040 2041 2042 2043 2044 2045 2046 2047 2048 2049 2050 2051 2052 2053 2054 2055 2056 2057 2058 2059 2060 2061 2062 2063 2064 2065 2066 2067 2068 2069 2070 2071 2072 2073 2074 2075 2076 2077 2078 2079 2080 2081 2082 2083 2084 2085 2086 2087 2088 2089 2090 2091 2092 2093 2094 2095 2096 2097 2098 2099 2100 2101 2102 2103 2104 2105 2106 2107 2108 2109 2110 2111 2112 2113 2114 2115 2116 2117 2118 2119 2120 2121 2122 2123 2124 2125 2126 2127 2128 2129 2130 2131 2132 2133 2134 2135 2136 2137 2138 2139 2140 2141 2142 2143 2144 2145 2146 2147 2148 2149 2150 2151 2152 2153 2154 2155 2156 2157 2158 2159 2160 2161 2162 2163 2164 2165 2166 2167 2168 2169 2170 2171 2172 2173 2174 2175 2176 2177 2178 2179 2180 2181 2182 2183 2184 2185 2186 2187 2188 2189 2190 2191 2192 2193 2194 2195 2196 2197 2198 2199 2200 2201 2202 2203 2204 2205 2206 2207 2208 2209 2210 2211 2212 2213 2214 2215 2216 2217 2218 2219 2220 2221 2222 2223 2224 2225 2226 2227 2228 2229 2230 2231 2232 2233 2234 2235 2236 2237 2238 2239 2240 2241 2242 2243 2244 2245 2246 2247 2248 2249 2250 2251 2252 2253 2254 2255 2256 2257 2258 2259 2260 2261 2262 2263 2264 2265 2266 2267 2268 2269 2270 2271 2272 2273 2274 2275 2276 2277 2278 2279 2280 2281 2282 2283 2284 2285 2286 2287 2288 2289 2290 2291 2292 2293 2294 2295 2296 2297 2298 2299 2300 2301 2302 2303 2304 2305 2306 2307 2308 2309 2310 2311 2312 2313 2314 2315 2316 2317 2318 2319 2320 2321 2322 2323 2324 2325 2326 2327 2328 2329 2330 2331 2332 2333 2334 2335 2336 2337 2338 2339 2340 2341 2342 2343 2344 2345 2346 2347 2348 2349 2350 2351 2352 2353 2354 2355 2356 2357 2358 2359 2360 2361 2362 2363 2364 2365 2366 2367 2368 2369 2370 2371 2372 2373 2374 2375 2376 2377 2378 2379 2380 2381 2382 2383 2384 2385 2386 2387 2388 2389 2390 2391 2392 2393 2394 2395 2396 2397 2398 2399 2400 2401 2402 2403 2404 2405 2406 2407 2408 2409 2410 2411 2412 2413 2414 2415 2416 2417 2418 2419 2420 2421 2422 2423 2424 2425 2426 2427 2428 2429 2430 2431 2432 2433 2434 2435 2436 2437 2438 2439 2440 2441 2442 2443 2444 2445 2446 2447 2448 2449 2450 2451 2452 2453 2454 2455 2456 2457 2458 2459 2460 2461 2462 2463 2464 2465 2466 2467 2468 2469 2470 2471 2472 2473 2474 2475 2476 2477 2478 2479 2480 2481 2482 2483 2484 2485 2486 2487 2488 2489 2490 2491 2492 2493 2494 2495 2496 2497 2498 2499 2500 2501 2502 2503 2504 2505 2506 2507 2508 2509 2510 2511 2512 2513 2514 2515 2516 2517 2518 2519 2520 2521 2522 2523 2524 2525 2526 2527 2528 2529 2530 2531 2532 2533 2534 2535 2536 2537 2538 2539 2540 2541 2542 2543 2544 2545 2546 2547 2548 2549 2550 2551 2552 2553 2554 2555 2556 2557 2558 2559 2560 2561 2562 2563 2564 2565 2566 2567 2568 2569 2570 2571 2572 2573 2574 2575 2576 2577 2578 2579 2580 2581 2582 2583 2584 2585 2586 2587 2588 2589 2590 2591 2592 2593 2594 2595 2596 2597 2598 2599 2600 2601 2602 2603 2604 2605 2606 2607 2608 2609 2610 2611 2612 2613 2614 2615 2616 2617 2618 2619 2620 2621 2622 2623 2624 2625 2626 2627 2628 2629 2630 2631 2632 2633 2634 2635 2636 2637 2638 2639 2640 2641 2642 2643 2644 2645 2646 2647 2648 2649 2650 2651 2652 2653 2654 2655 2656 2657 2658 2659 2660 2661 2662 2663 2664 2665 2666 2667 2668 2669 2670 2671 2672 2673 2674 2675 2676 2677 2678 2679 2680 2681 2682 2683 2684 2685 2686 2687 2688 2689 2690 2691 2692 2693 2694 2695 2696 2697 2698 2699 2700 2701 2702 2703 2704 2705 2706 2707 2708 2709 2710 2711 2712 2713 2714 2715 2716 2717 2718 2719 2720 2721 2722 2723 2724 2725 2726 2727 2728 2729 2730 2731 2732 2733 2734 2735 2736 2737 2738 2739 2740 2741 2742 2743 2744 2745 2746 2747 2748 2749 2750 2751 2752 2753 2754 2755 2756 2757 2758 2759 2760 2761 2762 2763 2764 2765 2766 2767 2768 2769 2770 2771 2772 2773 2774 2775 2776 2777 2778 2779 2780 2781 2782 2783 2784 2785

1000

1111
1110
1109
1108
1107
1106
1105
1104
1103
1102
1101
1100
1099
1098
1097
1096
1095
1094
1093
1092
1091
1090
1089
1088
1087
1086
1085
1084
1083
1082
1081
1080
1079
1078
1077
1076
1075
1074
1073
1072
1071
1070
1069
1068
1067
1066
1065
1064
1063
1062
1061
1060
1059
1058
1057
1056
1055
1054
1053
1052
1051
1050
1049
1048
1047
1046
1045
1044
1043
1042
1041
1040
1039
1038
1037
1036
1035
1034
1033
1032
1031
1030
1029
1028
1027
1026
1025
1024
1023
1022
1021
1020
1019
1018
1017
1016
1015
1014
1013
1012
1011
1010
1009
1008
1007
1006
1005
1004
1003
1002
1001
1000
999
998
997
996
995
994
993
992
991
990
989
988
987
986
985
984
983
982
981
980
979
978
977
976
975
974
973
972
971
970
969
968
967
966
965
964
963
962
961
960
959
958
957
956
955
954
953
952
951
950
949
948
947
946
945
944
943
942
941
940
939
938
937
936
935
934
933
932
931
930
929
928
927
926
925
924
923
922
921
920
919
918
917
916
915
914
913
912
911
910
909
908
907
906
905
904
903
902
901
900
899
898
897
896
895
894
893
892
891
890
889
888
887
886
885
884
883
882
881
880
879
878
877
876
875
874
873
872
871
870
869
868
867
866
865
864
863
862
861
860
859
858
857
856
855
854
853
852
851
850
849
848
847
846
845
844
843
842
841
840
839
838
837
836
835
834
833
832
831
830
829
828
827
826
825
824
823
822
821
820
819
818
817
816
815
814
813
812
811
810
809
808
807
806
805
804
803
802
801
800
799
798
797
796
795
794
793
792
791
790
789
788
787
786
785
784
783
782
781
780
779
778
777
776
775
774
773
772
771
770
769
768
767
766
765
764
763
762
761
760
759
758
757
756
755
754
753
752
751
750
749
748
747
746
745
744
743
742
741
740
739
738
737
736
735
734
733
732
731
730
729
728
727
726
725
724
723
722
721
720
719
718
717
716
715
714
713
712
711
710
709
708
707
706
705
704
703
702
701
700
699
698
697
696
695
694
693
692
691
690
689
688
687
686
685
684
683
682
681
680
679
678
677
676
675
674
673
672
671
670
669
668
667
666
665
664
663
662
661
660
659
658
657
656
655
654
653
652
651
650
649
648
647
646
645
644
643
642
641
640
639
638
637
636
635
634
633
632
631
630
629
628
627
626
625
624
623
622
621
620
619
618
617
616
615
614
613
612
611
610
609
608
607
606
605
604
603
602
601
600
599
598
597
596
595
594
593
592
591
590
589
588
587
586
585
584
583
582
581
580
579
578
577
576
575
574
573
572
571
570
569
568
567
566
565
564
563
562
561
560
559
558
557
556
555
554
553
552
551
550
549
548
547
546
545
544
543
542
541
540
539
538
537
536
535
534
533
532
531
530
529
528
527
526
525
524
523
522
521
520
519
518
517
516
515
514
513
512
511
510
509
508
507
506
505
504
503
502
501
500
499
498
497
496
495
494
493
492
491
490
489
488
487
486
485
484
483
482
481
480
479
478
477
476
475
474
473
472
471
470
469
468
467
466
465
464
463
462
461
460
459
458
457
456
455
454
453
452
451
450
449
448
447
446
445
444
443
442
441
440
439
438
437
436
435
434
433
432
431
430
429
428
427
426
425
424
423
422
421
420
419
418
417
416
415
414
413
412
411
410
409
408
407
406
405
404
403
402
401
400
399
398
397
396
395
394
393
392
391
390
389
388
387
386
385
384
383
382
381
380
379
378
377
376
375
374
373
372
371
370
369
368
367
366
365
364
363
362
361
360
359
358
357
356
355
354
353
352
351
350
349
348
347
346
345
344
343
342
341
340
339
338
337
336
335
334
333
332
331
330
329
328
327
326
325
324
323
322
321
320
319
318
317
316
31

1975-76

[illegible]

will be done by the

[illegible]

1997

1

10

臨

THE UNIVERSITY OF CHICAGO
LIBRARY

THE UNIVERSITY OF CHICAGO

I. BIBLIOGRAPHY

1. On rates of reactions in solid steel by E. C. Bain.
Transactions of the
American ~~Institute~~ of Mining and Metallurgical Engineers,
Vol. 13, page 100, year 1932.
2. Grain Size and Grain Growth by M. A. Grossman
Transactions of the American Society for
Steel Treating,
Vol. 21, page 1079, year 1933.
3. Grain Growth in Metals by M. A. Grossman
Transactions of the American Society for
Metals,
Vol. 22, page 861, year 1922.
4. Grain size and Hardenability and Normality of Steels
Transactions of the American Society by E.S. Davenport,
for Metals, and E.C. Bain.
Vol. 22, page 879, 1922.
5. Grain Size and Its Influence on Surface Decarbur-
ization of Steel by P.H. Rowland,
Transactions of the American Society and C. Unthegrove.
for Metals,
Vol. 24, page 96, 1936.
6. ~~Sounder~~ Stahlkunde, 1935, pages 68-75, E. Houdremont
7. Influence of Lattice Distortion on Diffusion in
Metals, by V.G. Mooredian
Transactions of the American ~~Institute~~ and J. T. Norton
of Mining and Metallurgical Engineers,
Vol. 117, page 89, 1935.
8. Thoriated Tungsten Filaments by I. Langmuir
J. Franklin Institute, Vol. 217, page 543, 1934.
9. The Mechanism of Crystal Growth by W. P. Davey
Transactions of the American Society for
Steel Treating,
Vol. 21, page 965, 1933.
10. Cementation Des Produits Metallurgiques,
L. Guillet, p.1-29, 53-65.
11. The Role of Energizers in Carburizing Compounds by G. M. Enos,
Transactions of the American Society for Steel
Treating,
Vol. 20, page 27, 1932.
12. Continuous gas Carburizing in Practice. by E. A. Thomas
Metals and Alloys, Vol. 3, page 84, 1932.

CONTENTS

1. A paper of reference to solid steel
by E. C. Bain.
2. A paper of reference to solid steel
by E. C. Bain.
3. A paper of reference to solid steel
by E. C. Bain.
4. A paper of reference to solid steel
by E. C. Bain.
5. A paper of reference to solid steel
by E. C. Bain.
6. A paper of reference to solid steel
by E. C. Bain.
7. A paper of reference to solid steel
by E. C. Bain.
8. A paper of reference to solid steel
by E. C. Bain.
9. A paper of reference to solid steel
by E. C. Bain.
10. A paper of reference to solid steel
by E. C. Bain.
11. A paper of reference to solid steel
by E. C. Bain.
12. A paper of reference to solid steel
by E. C. Bain.

13. Effect of Alloying Elements Upon Behavior of Steels in Case-hardening.
(Einfluss DER Legierungselemente Auf Das Verhalten Von Stählen Bei Der Einsatzhärtung) by Von E. Houdremont and H. Schrader,
Arch. Eisenhüttenw. Vol. 8, page 445, 1935.
14. Steel For Case-Hardening - Normal and Abnormal Steel, by S. Eustein and H. S. Rawdon
Bureau Standards Journal of Research,
Vol. 1, page 423, 1928.
15. The Effects of McQuaid-Ehn Grain Size on the Structure and Properties of Steel by P. Shand, Jr.
Transactions of the American Society for Metals,
Vol. 22, page 1038, 1932.
16. Heat treatment in Controlled Atmospheres Including Gaseous Carburizing, by C. R. Austin,
Transactions of the American Society of Metals,
Vol. 23, pages 168-170, 1935.
17. The Metallography and Heat Treatment of Iron and Steel, by A. Sauveur,
Fourth Edition, pp. 312-317.
18. Influence of special Elements on the Content of the Iron Carbon Eutectoid, by E. L. Reed,
Transactions of the American Society for Steel Treating,
Vol. 20, page 115, 1932.
19. Submicroscopic Inclusions in Steel, by C. H. Herty
Metal Progress Vol. 20-4, p. 37, or
Transactions of the American Society for Steel Treating,
Vol. 19, page 1, 1931.
20. Abnormality in Case Carburized Steels, by Herty, Larson,
Mining & Metallurgical Cooperative Krivobok, and co-workers.
Bulletin No. 45, 1929.
21. National Metals Handbook, 1933
American Society for Metals, pp. 350, 650, 907, 920.
22. Diffusion in Solid Metals, by R. F. Mehl,
Annual Lecture before American Institute of Mining and Metallurgical Engineers' meeting in New York in February 1936, and to be published by the Institute of Metals Division of that Society.
23. The Effect of McQuaid-Ehn Grain Size on Hardness and Toughness of Automotive Steels, by H. W. McQuaid,
Transactions of the American Society for Metals,
Vol. 22, page 1017, 1934.

- [illegible]

24. Gas Carburizing - a Discussion of Shop Practices, by H.W. McQuaid
Metal Progress (July 1934) p. 22.
25. Versuche Ueber Die Diffusion von Kohlenstoff, Silizium,
und Mangan in Festem und Flussigem Eisen, by Von M.
Arch. Eisenhutenw. Paschke, and A.
Vol. 9, pp. 305-6, 1935. Hauttmann,
26. The Gaseous Cementation of Iron and Steel, Part 1,
Carnegie Scholarship Memoirs, by A. Bramley and
Vol. 15, page 17, 1926. A. J. Jinkings,
27. The Gaseous Cementation of Iron & Steel, Part 2,
Carnegie Scholarship Memoirs, by A. Bramley and
Vol. 15, page 71, 1926. G. H. Beeby,
28. The Gaseous Cementation of Iron & Steel, Pt. IV, by A. Bramley and
Carnegie Scholarship Memoirs, G. Turner,
Vol. 17, page 23, 1928.
29. The Gaseous Cementation of Iron & Steel, Part VI,
Carnegie Scholarship Memoirs, by A. Bramley and
Vol. 18, page 1, 1929. H. D. Lord,

- [illegible]

AUG 31

BINDERY

Thesis 6301
W55 Whipple

AUTHOR

TITLE The carburization
of steels of "Krupp"
analysis.

DATE LOANED	BORROWER'S NAME	DATE RETURNED
		1
		of
		ial.

Thesis 6301
W55 Whipple


The carburization of
steels of "Krupp" anal-
ysis.

Library
U. S. Naval Postgraduate School
Monterey, California



thesW55

The carburization of steels of Krupp a

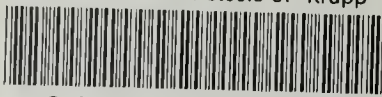

3 2768 001 95050 4

DUDLEY KNOX LIBRARY